
Inventory of Historic Resources in

FIFEVILLE-CASTLE HILL HISTORIC DISTRICT CHARLOTTESVILLE, VIRGINIA



Part 1: 4th Street NW – 9th Street NW





Primary Resource Information: Single Dwelling, Stories 1.50, Style: Other, ca 1870 July 2006: This currently abandoned 1½-story, 2-bay, frame dwelling was constructed in at least three sections. The modest house originally began as a 1-bay, 1½-story unit made up of the northern most part of the current dwelling. This would have included the current interior brick flue located within the steeply-pitched gabled roof. The front of the house was enlarged to its current configuration of two bays and then extended to the rear with a 1-story gable end wing and a side shed-roofed lean-to. The original weatherboard siding is visible beneath the current T-111 siding and the roof is now clad in asphalt shingles. None of the windows appear original and include jalousie windows with missing glass in the ½-story, boarded windows on the front and also on the rear wings, and modern 1/1 and 4/4-sash on the side elevation. Few details are evident as the house has been mothballed.

Individual Resource Status: Single Dwelling Contributing Total: 1

- 1 -



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1954 July 2006: Constructed in the mid-1950s, the house is sited perpendicular to the street. The 1-story, 3-bay, gable-end, frame dwelling rests on a concrete block foundation, with exposed rafter ends, new vinyl 1/1-sash windows, asphalt shingle roofing, asbestos siding, and a three-part bay window on the façade.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1957 July 2006: Constructed in 1957, the house is sited perpendicular to the street. The 1story, 1-bay, hip-roofed concrete block dwelling features a hipped roof, overhanging eaves, exposed rafter ends, an interior concrete block flue, steel casement windows with brick sills, and a side lean-to entrance bay with a shed-roofed hood supported by modern metal posts.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This late-19th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features a hipped roof with a projecting front cross gable. The roof is clad in asphalt shingles and a central brick chimney pierces it. The frame walls are covered in stucco, the vinyl-clad windows are replacement 6/6-sash, and the house has a plain friezeboard, gable-end returns, a transom over the front door, and a 3-bay hip-roofed front porch with square posts and a modern wooden balustrade. A 2-story wing extends to the rear.

Individual Resource Status: Single Dwelling Contributing Total: 1

- 4 -



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1875 July 2006: This 2-story, 2-bay, hip-roofed vernacular brick dwelling is laid in 6-course American bond. Architectural evidence suggests it was constructed ca. 1870 and it appears on the 1877 Gray's New Map of the area. The house has a full basement in the rear, taking advantage of the banked site. The side-passage-plan dwelling is double-pile and features overhanging eaves, 2/2-sash wood windows with brick jack arches over the first-floor openings, and a central brick flue. The 3-bay hip-roofed front porch has square posts on low stone piers as supports, a modern wooden cross-rail balustrade, and a solid stone foundation.

Individual Resource Status: Single Dwelling

Contributing Total: 1



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1925

July 2006: This 2-story, 4-bay, shed-roofed, gable-roofed, stuccoed frame duplex was constructed ca. 1925. The symmetrical building is comprised of two front entrances: the door is located on the end bay and a 2/2-sash window on the interior bay next to it. Each of these two bays are sheltered by a 2-bay shed-roofed porch with turned posts, plain balusters, and a side entrance. Architectural details include a parged split-level foundation, overhanging eaves, exposed rafter ends, modern vinyl 2/2-sash windows, and a central flue.



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Other, ca 1870 July 2006: Although this 1½-story, 2-bay, frame house is partially obscured by debris in the yard it retains much of its original integrity and appears to date to the late 19th century. It features an exterior brick chimney on the south elevation. The walls are clad in stucco and the gabled roof sheathed in rolled asphalt roofing. The eaves are deeply overhanging with exposed purlin ends. Four-light attic windows are located in the west end and a full-height 4/2 window is in the east gable end. The primary entrance of the building is now along the south side through a 1-story shed-roofed concrete block addition, although this does not appear to be the original entrance into the house. A 1story shed-roofed wing is located along the north side.



Primary Resource Information: **Single Dwelling**, **Stories 1.00**, **Style: Other, ca 1910** July 2006: This 1-story, 2-bay, gable-end, frame building was constructed ca. 1910 and features a raised brick foundation, vinyl siding, asphalt shingle roofing, new vinyl 1/1-sash windows and vinyl shutters, a central brick flue, and a side, 1-story, lean-to. The central front door is sheltered by a shed-roofed hood supported by wooden brackets. A 1-story wing with an interior flue is located in the rear as well as a modern deck with pergola.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1890 July 2006: This 1-story, 3-bay, frame vernacular dwelling is clad in board-and-batten siding and has an asphalt-shingled gabled roof. Constructed ca. 1890, the house rests on a brick foundation, and features 6/6-sash windows, overhanging eaves, vinyl louvered shutters, and a 1-bay, shed-roofed front porch with square posts. A rear shed-roofed wing contains an interior brick flue.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1855** July 2006: This 2-story, 3-bay, brick I-house with a central-front gable is believed to have been constructed in the mid-1850s by Chiles M. Brand. The front brick walls are laid in a 7-course Flemish bond variant and the side and rear brick walls and foundation in 7-course American bond. A mild Victorian interpretation of a vernacular I-house, the dwelling features a gabled roof of standing-seam metal, deeply overhanging eaves, and two interior-end brick chimneys. The house rests on a split-level brick foundation and that is full height in the rear. A large 2-story, hip-roofed, rear brick wing laid in 7-course American bond was constructed in the early 1920s. The house features 1/1-sash windows, a transom over the front door, and a 4-light basement window on the south side. The 3bay, hip-roofed front porch has Tuscan columns and a plain balustrade.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **2005** July 2006: Constructed in 2005, these six similar, 2-story, cross-gable-roofed frame cottages feature a projecting front cross gable. Very similar in design, they are clad in Hardi-plank siding, roofed in asphalt shingles and feature overhanging eaves, vinyl 2/2sash windows, and shed-roofed hoods supported by wooden brackets over the front entries. They are similar to the set of cottages on the other side of 5th Street. The cottages located directly along 5th Street is three stories in height with a raised basement level.

Individual Resource Status: Single Dwelling Non-Contributing Total:1 Individual Resource Status: Single Dwelling Non-Contributing Total:1



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1925

July 2006: This ca. 1925, 1¹/₂-story, 3-bay, Craftsman bungalow is of stone construction and features a hipped roof clad in asphalt shingles with a front and rear hip-roofed attic dormers that contain 6-light attic windows. Architectural details include single and paired 2/2 sash windows, overhanging eaves, exposed rafter ends, 3-light basement windows, concrete sills, and a large interior stone chimney on the south side that pierces through the eaves. A 3-bay, shed-roofed front porch features square stone posts and the rear shedroofed porch is screened in.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, 2005 July 2006: Constructed in 2005, these six similar, 2-story, cross-gable-roofed frame cottages feature a projecting front cross gable. Very similar in design, they are clad in Hardi-plank siding, roofed in asphalt shingles, and feature overhanging eaves, vinyl 2/2sash windows, and shed-roofed hoods supported by wooden brackets over the front entries. They are similar to the set of cottages on the other side of 5th Street.

· · · · · · · · · · · · · · · · · · ·
Individual Resource Status: Single Dwelling Non-Contributing Total:1
Individual Resource Status: Single Dwelling Non-Contributing Total:1
Individual Resource Status: Single Dwelling Non-Contributing Total:1
Individual Resource Status: Single Dwelling Non-Contributing Total:1
Individual Resource Status: Single Dwelling Non-Contributing Total:1
Individual Resource Status: Single Dwelling Non-Contributing Total:1



Primary Resource Information: Multiple Dwelling, Stories 2.00, Style: Other, ca. 1972

July 2006: Constructed in 1972, this 2-story, 9-bay, gable-roofed building contains nine townhouse units. Each is marked by a door and window bay and they open up to the parking area along the north side of the building. The walls are brick-veneered and the roof is clad in asphalt shingles. The 1x1 windows are sliding metal casements.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1915 July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a hipped roof with a front cross gable and was constructed ca. 1915. The frame walls are clad in stucco and the roof is covered in asphalt shingles. Architectural details include a louvered attic vent, overhanging eaves, plain friezeboard, and 2-bay hip-roofed front porch with square posts on brick piers and a brick porch floor. The 1/1-sash vinyl windows and metal front door are modern alterations. A 2-story, shed-roofed wing extends to the rear. Individual Resource Status: Single Dwelling Contributing Total:1



Primary Resource Information: Mixed:Commerce/Domestic, Stories 3.00, Style: Other, 2006

July 2006: This 3-story, gable and hip-roofed modern building has a commercial use on the first floor and condos on the upper floors. Three levels of metal balconies run along the zig-zag-shaped north façade. The building, which is clad in Hardi-plank board-and-batten, is painted purple, and was constructed in 2006.

Individual Resource Status: Mixed:Commerce/Domestic Non-Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1860** July 2006: This 2-story, 3-bay, gable-roofed, stuccoed vernacular dwelling features a 2-story, bi-level, pedimented entrance porch with decorative vergeboard. Believed to have been constructed ca. 1854-1864 by John T. Barksdale the single-pile symmetrical dwelling rests on a low foundation and has an asphalt shingled roof. The deeply overhanging eaves have a scalloped vergeboard on all sides. To the rear are a 2-story shed-roofed wing with a central brick flue and a rear 1-story shed-roofed wing. The 2-story, 1-bay front porch has square supports and a modern exterior stair allowing for access to the second-floor central door and porch. All the 2/2-sash windows have been replaced with modern 1/1-sash.

Individual Resource Status:	Single Dwelling Contributing	Total:1
Individual Resource Status:	Garage Non-Contribu	ting Total:1
Individual Resource Status:	Single Dwelling Contributing	Total:1
Individual Resource Status:	Single Dwelling Contributing	Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1915** July 2006: This 2-story, 3-bay, hip-roofed, asymmetrical vernacular dwelling features a central pedimented front gable. The house rests on a parged foundation with vinyl siding and asphalt shingle roofing. The 1/1-sash and 6/6-sash vinyl windows are modern. The 1bay shed-roofed front porch has battered square posts on vinyl-covered piers and a solid vinyl balustrade. The porch has a segmental-arched bay and is supported on a brick pier foundation with lattice between. Other details include overhanging eaves, and a rear partially enclosed rear porch.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a hipped roof with a front cross gable and was constructed ca. 1900. The frame walls are clad in stucco and the roof is covered in asphalt shingles. Architectural details include overhanging eaves, a plain friezeboard, gable-end returns, sidelights around the front door, 4/1-sash windows, and a 3-bay hip-roofed front porch with square posts on stuccoed square piers. A 1-story, shed-roofed enclosed porch is located in the rear. Individual Resource Status: Single Dwelling Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1900** July 2006: This 2-story, 2-bay, side-passage-plan vernacular brick dwelling is laid in 7-course American bond and features a hipped roof with lower cross gables and a rear gable dormer. The well-preserved Victorian-detailed dwelling, constructed ca. 1900, features penciled mortar joints under the porch, a low brick foundation, a 2-light transom with a segmental arch over the front door, basement windows, and a central-front gable with wooden fishscale shingles and an attic window. The 3-bay, hip-roofed front porch has Tuscan column supports and a denticulated cornice. Other architectural details include a large central brick chimney that has been partially parged, a plain wooden frieze, overhanging eaves, wooden shingles and a 4-light attic window in the side cross gable, and a wraparound, partially enclosed side and rear 1-story porch.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a hipped roof with a 7-bay wraparound front porch. Constructed ca. 1900, the frame walls are clad in stucco and the roof is covered in asphalt shingles. Architectural details include overhanging eaves, modern 1/1 windows, a rear cross-hipped wing with an enclosed shed-roofed porch and modern rear deck. The 7-bay porch features stuccoed posts and round-arched stuccoed bays.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca. 1973 July 2006: This 1-story, 4-bay, gable-roofed, brick and board-and-batten vernacular dwelling was constructed in 1973 and features 8/8-sash windows, Texture T-111 siding in the gable ends, and an integral 3-bay front porch.



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Colonial Revival, ca 1925

July 2006: This eclectic 1¹/₂-story, 2-bay stuccoed bungalow has a jerkinhead roof with a large shed-roofed side dormer. Constructed ca. 1925, the frame walls are clad in stucco, the foundation is parged, and the roof covered in asphalt shingles. Architectural details include single and paired 4/1 windows, wooden triangular brackets supporting the overhanging eaves, exposed rafter ends, 3-light basement windows, a gable-hood entry supported by triangular brackets, and a partially engaged corner porch with triple Tuscan column supports and a modern wooden railing.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca. 1870** July 2006: This 2-story, 3-bay, brick I-house with a central-front gable is believed to have been constructed before 1876 when it was sold by John N. Fry to John and Rebecca Shelton, who were living in the house at that time. Architecturally the house appears to have been constructed ca. 1870. The front brick walls are laid in a 7-course-Americanwith-Flemish-bond and the side and rear brick walls and foundation in 7-course American bond. A Victorian interpretation of a vernacular I-house, the dwelling features a bellcast gabled roof of standing-seam metal, deeply overhanging bracketed eaves, and a projecting polygonal bay window on a brick foundation. The bay window and the 1-bay front porch, which has modern metal supports and a bracketed cornice, both have Mansard roofs. The 2/2-sash windows, two semi-exterior-end brick chimneys that break through the eaves, the 5-light transom and 3-light sidelight around the front door and the basement windows all appear original. A 1-story frame wing on raised basement extends the full width of the rear of the house and appears to have been constructed in several sections.

Individual Resource Status:	Single Dwelling Contributing	Total: 1
Individual Resource Status:	Shed Non-Contributing	Total: 1
Individual Resource Status:	Shed Non-Contributing	Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This large, rambling, 2-story, 2-bay, Victorian dwelling features a hipped roof with lower cross gables and appears to have been recently renovated. All the 1/1-sash windows as well as the full-light doors are modern replacements. The roof has been covered in asphalt shingles and the chimneys removed. The brick foundation, overhanging eaves, gable-end returns, weatherboarded exterior walls with corner boards, and square wooden shingles and Gothic-arched attic windows in the gable ends appear original. The house features a 7-bay wraparound porch with a corner entry, turned posts and plain pickets. The 2-story cross-gable-roofed rear wing has similar detailing to the front portion.

Individual Resource Status:	Single]	Dwelling Contributing	Total:1
Individual Resource Status:	Shed	Non-Contributing	Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This 1890s, 2-story, 2-bay, cross-gable-roofed, side-passage-plan, vernacular frame dwelling features a projecting front cross gable. The roof is clad in standing-seam metal while the walls have been covered with aluminum siding. Because of the sloped site, the parged foundation is split-level. A parged chimney toward the rear of the building was observed. The 2/2-sash windows, plain friezeboard, gable-end returns, front-entry transom, and 2-bay front porch with Tuscan columns and plain balustrade appear original. To the rear is a 1-story wing.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This ca. 1900, 2-story, 2-bay, gable-roofed side-passage-plan dwelling is currently vacant and boarded up. The walls are clad in aluminum siding, the roof is covered in asphalt shingles, the cornices have gable-end returns, and a transom is located above the front door. The windows and doors have been covered in plyboard. A 2-story wing extends to the rear. The 2-bay, hip-roofed front porch has square posts and a solid concrete balustrade that extends beyond the porch roof.



Primary Resource Information: Mixed:Commerce/Domestic, Stories 2.00, Style: Other, ca 1900

July 2006: This ca. 1900, 2-story, 3-bay, gable-end frame building is clad in aluminum siding on the façade and stucco on the sides and rear. The windows and door on the first floor are all modern replacements and suggest that the front originally had a storefront or some other type of opening. The gable-end front features gable-end returns and a boxed cornice. The side elevation shows a plain frieze and original 2/2-sash windows. To the rear is a 2-story shed-roofed wing with a set of modern exterior stairs leading to a second-story apartment.

Individual Resource Status: Mixed:Commerce/Domestic Contributing Total:1



308 5th Street SW 104-0213-0164

Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This late-19th-century, 2-story, gable-roofed dwelling is one of three almost identical houses sited next to each other on 5th Street. They are comprised of a 2-bay main block with an exterior-end brick chimney and have a slightly recessed, 1-bay, 1- or 2-story side wing off the side with the chimney. This house is clad in stucco, roofed in standing seam metal, and features overhanging eaves, 6/6-sash windows, and multiple rear 1-story wings. The 4-bay hip-roofed front porch, which has stuccoed square posts, a solid balustrade, and wooden steps and handrail, unites both front sections of the house. Individual Resource Status: Single Dwelling Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay hip-roofed vernacular dwelling has a cantilevered second floor over an enclosed first floor porch that has two doors and lattice-covered walls. The second floor is clad in stucco and the roof with overhanging eaves is covered in standing-seam metal. The 1/1 windows are modern and the house appears to have a 2-story rear lean-to addition.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 2-story, gable-roofed dwelling is one of three almost identical houses sited next to each other on 5th Street. They are comprised of a 2-bay main block with an exterior-end brick chimney and have a slightly recessed, 1-bay side wing off the side with the chimney. This house is the only one of the three with a 1-story side wing: the others have a 2-story side wing. This house, clad in vinyl siding with an asphalt shingled roof, features a parged brick chimney, overhanging eaves, 6/6-sash windows, and multiple rear 1-story wings. The 4-bay hip-roofed front porch, which has square posts, a plain balustrade, and concrete steps, unites both front sections of the house.



Primary Resource Information: Mixed:Commerce/Domestic, Stories 2.00, Style: Other, ca 1900

July 2006: This 2-story, 3-bay, shed-roofed brick building was constructed at the turn-ofthe century. Commercial use was on the first floor and living space on the second, as was common with many commercial buildings of this era in urban areas. The three-part wooden storefront topped by a denticulated and bracketed entablature is intact and is comprised of large, fixed, 4-light, wood windows over paneled reveals flanking a doubleleaf, wood and glass door. The second floor facade is comprised of three, unevenly spaced, 1/1-sash windows with segmental arches. Two of the windows are centered above the storefront and the third is centered above the blank wall on the first floor, which may have at one time contained a door leading to a second-story stair. The building also features a corbelled brick cornice with overhanging wood entablature, a shed roof, a split-level brick foundation, two interior brick chimneys, and a modern rear deck. The building is now only used residentially.

Individual Resource Status: Mixed:Commerce/Domestic Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This late-19th-century, 2-story, gable-end dwelling is one of three almost identical houses sited next to each other on 5th Street and is the best preserved. They are comprised of a 2-bay, gable-end main block with an exterior side brick chimney and each has a slightly recessed, 1-bay side wing off the side with the chimney. The wing has a side gable roof. This house is one of two with a 1-story side wing: the other has a 2-story side wing. The second floor has only a one bay, which is centered in the gable end and is located above the first-floor window. Clad in vinyl siding with an asphalt-shingled roof, the house features a parged brick chimney, overhanging eaves, 2/2-sash wood windows, exposed rafter and purlin ends, a Craftsman-style door, a scroll bracket in the front gable end, and a side 1-story gable-roofed wing with a side wing. The 1-bay hip-roofed front porch, which has rectangular stuccoed posts, a solid balustrade, and a round-arched bay, runs the full width of the main block.

Individual Resource Status: Single Dwelling Contributing Total:1

- 33 -

TYPE 5



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This late-19th-century, 2-story, gable-end dwelling is one of three almost identical houses sited next to each other on 5th Street. They are comprised of a 2-bay, gable-end main block with an exterior side brick chimney and each has a slightly recessed, 1-bay side wing off the side with the chimney. The wing has a side gable roof. This house is the only one with a 2-story side wing: the other 2 have 1-story side wings. The second floor has only a one bay, which is centered in the gable end and is located above the first-floor window. Clad in stucco with an asphalt-shingled roof, the house features a brick chimney, overhanging eaves, modern 1/1-windows, some original 2/2-sash windows, modern vinyl shutters, and a side porch off the side wing. The 2-bay hip-roofed front porch has paneled square posts as supports and runs the full width of the main block.




Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This late-19th-century, 2-story, gable-roofed dwelling is one of three almost identical houses sited next to each other on 5th Street. They are comprised of a 2-bay main block with an exterior-end brick chimney and have a slightly recessed, 1-bay, 1- or 2-story side wing off the side with the chimney. This house is clad in stucco, roofed in standing asphalt shingles, and features overhanging eaves, modern 1/1-sash windows, and a rear 1-story wing. The 2-bay hip-roofed front porch, which has stuccoed square posts, and a solid balustrade, only covers the main block of the house.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This late-19th-century, 2-story, gable-end dwelling is one of three almost identical houses sited next to each other on 5th Street. They are comprised of a 2-bay, gable-end main block with an exterior side brick chimney and each has a slightly recessed, 1-bay side wing off the side with the chimney. The wing has a side gable roof. This house is one of two with a 1-story side wing: the other has a 2-story side wing. The second floor has only a one bay, which is centered in the gable end and is located above the first-floor window. Clad in vinyl siding with an asphalt-shingled roof, the house features a parged brick chimney, overhanging eaves, modern 1/1-windows, a small scroll bracket in the front gable end, and a side 1-story gable-roofed wing. The 1-bay gabled front porch has battered columns on prick piers and runs the full width of the main block. *Individual Resource Status:* Single Dwelling Contributing Total:1

405 5th Street SW 104-0213-0175

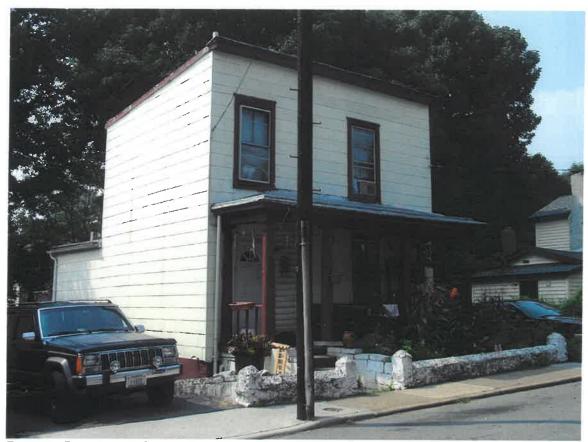

Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, side-passage-plan vernacular dwelling features a shed roof with a small bracketed parapet. The house rests on a brick foundation, the walls are clad in asbestos shingles, and the roof is covered in standing-seam metal. The 2/2-sash windows appear original while the front door is a modern replacement. To the rear is a 1- story wing. The 3-bay front porch features Tuscan columns, plain balusters, and a hipped roof.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890
July 2006: This 2-story, 2-bay, gable-roofed with a central-front gable frame dwelling
was constructed ca. 1890. Neither the two bays nor the front gable are centered within the façade, giving the building an interesting appearance. The stuccoed house has modern
1/1-sash windows, a new bay window on the front, a standing-seam metal roof,
overhanging eaves, a new front door, a rectangular attic vent in the central front gable, a
rear 2-story wing with side entrance and porch, and a 3-bay front porch with square posts.
Individual Resource Status: Single Dwelling Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1910** July 2006: This currently vacant, ca. 1910, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features an asphalt shingled roof, overhanging eaves, 1/1 vinyl windows (the first-floor openings have been boarded up), a parged foundation, Hardiplank siding, a 2-story rear shed-roofed wing, and a 3-bay front porch with turned posts and a modern balustrade.



Primary Resource Information: **Single Dwelling**, **Stories 1.00**, **Style: Other**, **ca 1950** July 2006: This 1-story, 3-bay, concrete block vernacular dwelling appears to have been constructed around 1950. It has a hipped roof, clad in asphalt shingles, with overhanging eaves, exposed rafter ends, and an interior concrete block flue. The paired windows are 6/6-sash and the house has a split-level foundation that opens to a full basement level on the south side. Several rear additions have been made to this house making it quite large. A number of exterior doors suggest that it may have been divided into several living units. The large, pedimented, 3-bay front porch has square columns, a solid balustrade, and an aluminum awing.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, gable-roofed with a central-front gable frame dwelling was constructed ca. 1890. Neither the two bays nor the front gable are centered within the façade, giving the building an interesting appearance. The stuccoed house has 2/2-sash windows, asphalt shingled roofing, a 6-light transom and sidelights around the front door, an exterior brick chimney along the rear gable side, overhanging eaves with exposed rafter ends, and a plain friezeboard. The 1-story, gable-roofed, stuccoed rear wing has a side lean-to, a basement entry, and an exterior-end concrete block flue. The 3-bay, hip-roofed front porch has square stuccoed supports that form segmental-arched bays, and a solid balustrade.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1955** July 2006: Constructed ca. 1955, this 2-story, 3-bay, gable-roofed vernacular dwelling is of concrete block construction on the first floor and frame that has been stuccoed on the second floor. The roof is clad in asphalt shingles and features a central concrete block flue. The windows are 6/6-sash and the house has overhanging eaves, exposed rafter ends, and porches on three sides.

418 5th Street SW 104-0221 Other DHR Id #: 104-0213-0168



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Federal, ca 1832

July 2006: Constructed in 1832, the left three bays of this 1-story brick dwelling are original and follow a side-passage plan. The exterior brick chimney that was originally on the south end of the house was incorporated into the side 1-bay 1-story brick wing that was added in 1892. The walls of the wing were built around the chimney with the exception of the area above the roof level, thus not having to disturb attic windows in the gable end of the original section. The original 3-bay asymmetrical section is laid in Flemish bond brick on the façade and 5-course American bond on the sides and rear. The mousetooth brick cornice, 6-panel front door with architrave trim, 6/6-sash windows, and parged brick foundation are all in good condition. The side brick wing is laid in 7-course American bond, typical of its late-19th century period, but has a matching mousetooth cornice. A rear 1-story frame wing on a brick foundation appears to be a modern addition yet blends in with the rest of the house.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1940 July 2006: Constructed ca. 1940, this 1-story, 3-bay, gable-end vernacular dwelling is clad in asbestos shingle and has an asphalt-shingled roof. The house rests on a concrete block foundation and features 6/6-sash windows, overhanging eaves, a full size attic window in the front gable end, exposed rafter ends, a central interior brick chimney, and a 3-bay shed-roofed front porch with square posts and plain pickets.



Primary Resource Information: Foundation,

July 2006: This site includes a rectangular concrete block foundation that is currently under construction on this site. The floor joists have not yet been set but the metal vents are in (NC Site).

Individual Resource Status: Foundation Non-Contributing Total:1




Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 1890s, 2-story, 2-bay, cross-gabled, side-passage vernacular frame dwelling features a projecting front cross gable. The roof is clad in asphalt shingles and the walls in aluminum siding. The 2/2-sash windows, gable-end returns, transom over the door, and 3-bay front porch with turned posts appear original. Because of the sloped site, the rear of the house has a full basement level. A side 1-story, shed-roofed 1-story wing with modern exterior stairs is on the south side of the rear ell.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 1890s, 2-story, 2-bay, cross-gabled, side-passage, vernacular frame dwelling features a projecting front cross gable and has two front doors, suggesting it is now used as a duplex. The projecting cross gable has a central door on the first floor with a window above it on the second floor. The recessed portion is two bays with a door and small Queen-Anne-sash window on the first floor and a window on the second floor that lines up with the first-floor door. The roof is clad in asphalt shingles and the walls are stuccoed except under the porch where they are covered in wood paneling. The 1/1 windows are modern replacements but the plain friezeboard and gable-end returns are original. The 4-bay hip-roofed front porch has stuccoed piers, a solid balustrade and segmental-arched stuccoed bays. Because of the sloped site, the rear of the house has a full basement level. A rear ell project from the house and has a large modern deck.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This late-19th-century, 2-story, 2-bay, side-passage, gabled vernacular dwelling has stucco siding, a standing-seam metal roof, 2/2-sash windows, overhanging eaves, and an exterior parged brick chimney along the rear gable side. The transom above the door has been enclosed although the 5-light sidelights are still intact. The 2-bay front porch has stuccoed posts, modern metal railing, and segmental bays formed by stuccoed trim. A 2-story rear ell with 6/6-sash windows and an interior-end brick flue extends to the rear and contains a side porch with shed-roofed second-story wing on the porch roof. Individual Resource Status: Single Dwelling Contributing Total:1

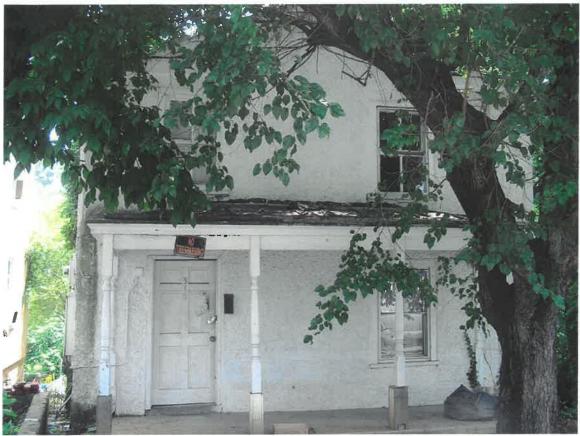

Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: Currently vacant, this late-19th-century, 2-story, 2-bay, hip-roofed, side-passage, vernacular frame dwelling features a central-front gable. Clad in stucco with a standing-seam metal roof, the house features overhanging eaves, a plain frieze, 2/2-sash wood windows, gable-end returns, a 6-panel front door, a rear 2-story hip-roofed wing on a split-level foundation, and a 3-bay hip-roofed front porch with turned posts and a concrete floor.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This late-19th-century, 3-bay, 2-story, hip-roofed, frame I-house features a central-front gable, parged foundation, stucco siding, and an asphalt shingled roof. It contains 2/2-sash windows, 2 interior central concrete block flues, overhanging eaves, gable-end returns, a round wooden attic vent in the front gable end, a plain friezeboard, and a rear 2-story hip-roofed wing with flue and 6/6-sash windows. Off its south side is a 1-story, shed-roofed wing with a modern rear deck. The 3-bay front porch features turned posts and a modern balustrade.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 3-bay, side-passage, gable-roofed vernacular dwelling is clad in stucco, and has an asphalt shingled roof, modern 1/1 windows, vinyl shutters, and a 2-story side wing off the south end that surrounds what was once an interior-end brick chimney to the main block. Constructed during the late-19th-century, the house features overhanging eaves, a 4-light transom (with the numbers 314 in gold lettering) and 3-light sidelights around the door, and a 2-bay hip-roofed front porch with chamfered posts and a cut-out frieze and brackets with a quatrefoil design. The rear of the house has a full basement because of the sloped site as well as a screened-in rear porch.





Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1910** July 2006: This fairly large, 2 ½-story, asymmetrical, 2-bay, early-20th-century, frame dwelling is a variation of the American Foursquare and contains Colonial Revival-style elements. Resting on a parged foundation, the walls are clad in vinyl siding and hipped roof with lower cross gables is covered in standing-seam metal. An oversized hip-roofed front dormer features paired modern windows and overhanging eaves. The 6/1-sash windows are all replacement but the 3-light sidelights around the door, the overhanging eaves, the gable-end returns, and the 3-bay front porch with Tuscan columns appear original. A 2-story rear ell with side-2-story shed-roofed wing extends to the rear in addition to a 1-story wing with an interior brick chimney.

Individual Resource Status: Single Dwelling Contributing Total:1

52 -

TUPE 7



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: Constructed ca. 1890, this 2-story, vernacular dwelling features a hipped roof with lower cross gables. The 3-bay façade features an asymmetrical cross gable and a central entrance. The house is clad in stucco but features its original standing-seam metal roof. Architectural details include gable-end returns, a plain friezeboard, 2/2-sash wood windows, vinyl shutters, and a 3-bay hip-roofed front porch with stuccoed square posts and round-arched stuccoed bays. The house rests on a split-level foundation due to the sloped site and has a full basement entry on the rear elevation.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: Constructed in the early 1890s, this 2-story, 2-bay, gable-end vernacular dwelling features a decorative sawn vergeboard that goes all the way around the house, giving it a Victorian feel. The asymmetrical, side-passage plan house features overhanging eaves, a triangular attic vent in the front gable end, an exterior-end brick chimney on the rear end, 2/2-sash windows, stucco siding, and a standing-seam metal roof. The rear 2-story gable wing has a 2-story side shed-roofed addition and a 1-story enclosed rear porch. The 1-bay, shed-roofed, Craftsman-style, front porch has battered stuccoed posts on stuccoed piers with a solid stuccoed balustrade and aluminum awnings. Individual Resource Status: Single Dwelling Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1910** July 2006: This early-20th-century, 2-story, 2-bay, cross-gable-roofed, side-passage-plan, vernacular frame dwelling rests on a foundation that is of brick piers with concrete block infill. It features a standing-seam metal roof, weatherboard siding, 2/2 windows, overhanging eaves, a plain friezeboard, gable-end returns, a transom over the front door, and rear 2-story wing. The 3-bay, hip-roofed, Victorian porch is supported by turned posts with scroll brackets.

*327 6th Street SW 104-0233 Other DHR Id #: 104-0213-0144




Primary Resource Information: Single Dwelling, Stories 2.00, Style: Second Empire, ca 1879

July 2006: Listed on the National Register of Historic Places as part of the Charlottesville Multiple Resource Area District, this dwelling combines the Italianate, Second Empire and Gothic Revival architectural styles, all of which were popular during the mid-to-late 19th century. The asymmetrical house is comprised of a 1 ¹/₂-story, 2-bay, single-pile side-passage-plan, gable-roofed main block with an off-center gable-roofed front wall dormer that breaks through the overhanging eaves and gives the house its Gothic Revival aspect. This section contains the front entrance door which is topped by a 2-light transom. The walls are stuccoed, and the standing-seam metal roof contains a central brick chimney. A 3-bay hip-roofed front porch is supported by turned posts. The windows on this section are varied: the dormer contains paired 4/4-sash, the front window 1/1-sash, and the side elevation 6/9-sash. A 2-story, 2-bay, gable-roofed wing with 6/6-sash windows, and an enclosed 1-story, shed-roofed, porch along the south side extends to the rear. A visually prominent 2-story, 1-bay tower with a Mansard roof projects forward along the northeast side of the main block, lending Second Empire and Italianate elements to the dwelling. A full two stories tall, the stuccoed tower features narrow paired 1/1-sash windows on the both floors, overhanging eaves, a plain frieze and steeply pitched Mansard roof clad with metal plates. The house was constructed between 1875 and 1879 and was in this basic configuration when it appeared on the 1907 Sanborn Map. It is a very interesting vernacular adaptation of popular Romantic architectural styles of the period and unlike any other in the district.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This late-19th-century, 2-story, 2-bay, side-passage plan, gable-roofed dwelling has been somewhat remodeled. The walls are clad in vinyl siding, the 1/1-sash windows are replacements, and the roof has been covered in asphalt shingles. Original features include overhanging eaves, a 3-bay hip-roofed front porch with square posts, a transom over the door, and a rear 2-story wing.

Individual Resource Status:Single Dwelling ContributingTotal:1Individual Resource Status:ShedNon-ContributingTotal:1

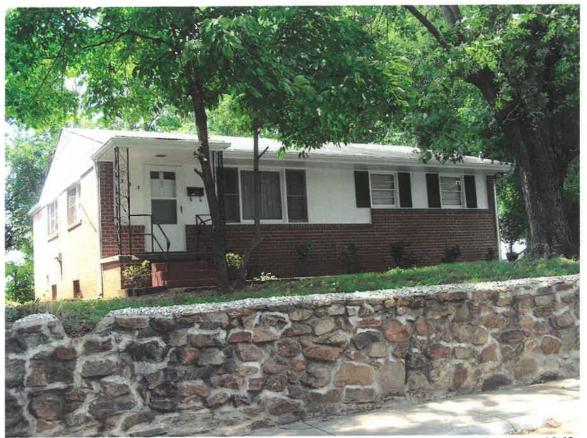

Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1968 July 2006: This 1-story, 4-bay, gable-roofed, brick and frame vernacular dwelling was constructed in 1968 and features bay windows, horizontal 1/1-sash, some Texture T-111 siding, basement windows along the south wall, and a 1-bay shed-roofed porch with modern metal posts.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This early-20th-century, 2-story, 2-bay, cross-gable-roofed, side-passage-plan, vernacular frame dwelling rests on a parged foundation and features a standing-seam metal roof, weatherboard siding, modern 6/6-sash windows, overhanging eaves, a plain friezeboard, gable-end returns, and rear 2-story wing. The 3-bay, hip-roofed, Colonial Revival-style front porch is supported by chamfered posts with a plain balustrade and a modern metal handrail along the front concrete steps.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This late-19th-century, 2-story, 2-bay, cross-gabled, side-passage, vernacular frame dwelling rests on a parged foundation and features a standing-seam metal roof, stuccoed walls, modern 1/1-sash windows, a plain frieze, gable-end returns, a round wooden attic vent in the front gable end, a modern front door, and a 2-story rear wing. The 3-bay, hip-roofed front porch, supported by turned posts, has segmental-arched bays created by wood trim with small brackets.

Individual Resource Status: Single Dwelling Contributing Total:1 Individual Resource Status: Shed Non-Contributing Total:1



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1957 July 2006: Constructed in 1957, this 1-story, 3-bay, hip-roofed vernacular dwelling has an asphalt shingled roof, stucco siding, a brick apron on the front with paneling above, and an exterior-end brick chimney. Other details include a bay window, 6/6 and 4/6-sash windows, metal basement windows, a split-level basement, a 2-bay shed-roofed front porch with metal supports, and a rear enclosed porch with jalousie windows that is supported on metal poles.



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1910

July 2006: This 2-story, 4-bay, shed-roofed, brick duplex was constructed ca. 1910 with brick laid in a 6-course American bond pattern. The symmetrical building is comprised of two front entrances: the door is located on the end bay and a 6/6-sash window on the interior bay next to it. Each of these two bays are sheltered by a 1-bay shed-roofed porch with square posts, a modern balustrade, and a side entrance with stairs. The split-level foundation is of brick and the 6/6-sash windows have segmental brick jack arches above them. Original 1-story rear brick wings have a second-story addition of frame with stucco and an additional shed-roofed 2-story concrete block wing off the rear.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1963 July 2006: Constructed in 1963, this 1-story, 3-bay, gable-roofed, Minimal Ranch is of concrete block construction and has a split-level foundation with walk out basement on the northwest corner, an asphalt-shingled roof, 1/1 windows, a central flue, and a modern deck as a front porch.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This late-19th-century, 2-story, 3-bay, vernacular I-house dwelling has been moderately remodeled and includes stucco siding, an asphalt shingled roof with overhanging eaves, modern 6/6-sash windows, and a rear 1-story shed-roofed wing with modern deck. The 2-bay, hip-roofed front porch has stuccoed square posts and stuccoed segmental-arched bays.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900, later modifications

July 2006: The center portion of this vernacular dwelling appears to have had a gable-end roof and is now enclosed within the current building. Because so many alterations have been made to this house, including modern Hardi-plank siding, modern 6/6-sash windows, a large 2-story wrap-around addition, the loss of the front porch, and the movement of the front entrance to the south side of the house, much of the architectural integrity of the historic building has been lost, rendering it as a non-contributing resource in the district.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, asymmetrical, side-passage-plan vernacular frame dwelling was constructed ca. 1900. The gable roof is clad in asphalt shingles and the walls are covered in asbestos shingles. The 1/1 windows and vinyl shutters are modern replacements. The 2-bay shed- roofed front porch with square supports and plain balustrade has a side entrance. A denticulated wood cornice trim that appears modern is located along the front of the house and along the inside of the porch roof.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1965 July 2006: Constructed in 1965, this 1-story, 4-bay, gable-roofed, brick Minimal Ranch house has an asphalt shingled roof with overhanging 2-bay porch, 8/8 windows, and an exterior-end brick chimney.

Individual Resource Status:Single DwellingNon-Contributing Total:1Individual Resource Status:ShedNon-Contributing Total:1



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1922

July 2006: This 1½-story, 3-bay, frame dwelling was constructed ca. 1922 and is a wellpreserved example of a vernacular Craftsman Bungalow. The frame house is clad in aluminum siding and features a gabled roof covered in asphalt shingles. A large oversized shed-roofed dormer is located along the front gable. The 4-bay, full-width, 1-story, shedroofed front porch has battered wooden supports on brick piers and a modern wooden balustrade. Other details include a brick foundation, modern single and paired 6/6-sash windows, overhanging eaves, and sidelights around the front door.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900

July 2006: Constructed in the mid-1960s, this 1-story, 3-bay, gable-end vernacular dwelling rests on a brick foundation. The walls are clad in Masonite siding and the roof in asphalt shingles. The 1/1-sash windows are covered by aluminum awnings, as is the 2-bay hip-roofed corner porch that has square supports, a solid balustrade, and aluminum awnings.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This late-19th-century, 2-story, 3-bay, vernacular I-house features a central front gable, overhanging eaves, a central entry, a 3-bay hip-roofed front porch with turned posts, a parged foundation, modern 6/6-sash windows, and a rear shed-roofed 1-story wing with modern deck.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 2-story, 3-bay, vernacular I-house features a central front gable, overhanging eaves, and exterior-end brick chimneys. A secondary door that was added to the front of the house when it was converted into a duplex now makes the house four bays wide; it was originally a 3-bay symmetrical front. Architectural details include stuccoed exterior walls, an asphalt shingled roof, 6/6-sash windows, a 3-bay hip-roofed front porch with square posts and 2-rail balustrade, and a rear 2-story gable-roofed wing.

330, 332 6 ½ Street SW 104-0213-0129



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1910

July 2006: This 2-story, 4-bay, hip-roofed, frame duplex was constructed ca. 1910. The symmetrical building is comprised of two front entrances: the door is located on the end bay and a 1/1-sash modern window on the interior bay next to it. Each of these two bays are sheltered by a 2-bay shed-roofed porch with square posts, 2-rail balustrade, aluminum awnings, and a side entrance with concrete stairs. The split-level foundation is parged and the front windows have aluminum awnings over them. The building is clad in aluminum siding and the roof in asphalt shingles. Original 1-story rear wings each have a second-story shed-roofed addition.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This asymmetrical, 2-story, 2-bay, cross-gable-roofed vernacular dwelling has a large, off-center, central-front gable. The walls are clad in vinyl siding and the 1/1 windows and asphalt shingled roofing are all modern replacements. Architectural details include gable-end returns, a parged foundation, a plain frieze, an enclosed transom over the door, a 3-bay shed-roofed front porch with square posts, and a 1-story shed-roofed rear wing. The house is almost identical in design to the house next door at 333 6 $\frac{1}{2}$ Street.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This asymmetrical, 2-story, 2-bay, cross-gable-roofed vernacular dwelling has a large, off-center, central-front gable. The walls are stuccoed and the house features an asphalt shingled roof, gable-end returns, a parged foundation, 2/2-windows, a plain frieze, a transom over the door, a 3-bay hip-roofed front porch with turned posts, and a 2-story shed-roofed rear wing. The house is almost identical in design to the house next door at 331 6 $\frac{1}{2}$ Street.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 2006 July 2006: Currently under construction, this is a 2-story, 3-bay, shed-roofed frame house clad in vinyl siding with 1/1 vinyl windows and overhanging eaves. It rests on a splitlevel foundation and is somewhat taller than most of the neighboring buildings. Individual Resource Status: Single Dwelling Non-Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style**: **Other**, **ca 1900** July 2006: The original section of this 2-story vernacular dwelling appears to be the 2bay, side-passage-plan, gable-end section to the north. The original cross-gable-roofed form of this section is still visible. A 2-story, shed-roofed, 1-bay side addition with an interior flue was added to the south giving the building its current configuration. A 3-bay, hip-roofed porch with stuccoed square posts, a solid stuccoed balustrade, and segmentalarched stuccoed bays ties both sections together. Constructed ca. 1900, the house has stuccoed walls, a standing-seam metal roof, modern 1/1-sash vinyl windows, and a parged foundation.

Individual Resource Status: **Single Dwelling** Contributing *Total:*1 *Individual Resource Status:* **Shed** Contributing *Total:*1



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1961 July 2006: Constructed in 1961, this 1-story, 2-bay, gable-end frame building is clad in aluminum siding and has a split-level concrete foundation. The gabled roof is covered in asphalt shingles, the metal windows are sliding casements, and a 3-bay porch made of an aluminum awning supported by modern metal posts is located at the front entrance.



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1910

July 2006: This late-19th-century, 2-story, 2-bay, cross-gable-roofed, side-passage-plan, vernacular frame dwelling features a projecting front cross gable. The roof is clad in standing-seam metal while the walls have been covered in vinyl siding. The 2/2-sash windows, overhanging eaves, brick foundation, transom over the door, and 3-bay front porch with turned posts appear original. The 4-rail balustrade appears to be a later alteration. A 2-story, shed-roofed wing extends to the rear.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style**: **Other**, **ca 1880** July 2006: This 2-story, 2-bay, side-passage-plan, gable-roofed brick building is laid in a 7-course American-with-Flemish bond on the facade and 7-course American bond on the sides and rear. The building is two bays wide on the first floor and one-bay wide at the second, with the window opening on the second floor lining up with the window on the first floor. The gabled roof is clad in standing-seam metal with no visible chimney, and the double-hung wood windows have 6/6-sash. Constructed ca. 1880, the house features a single transom over the door, overhanging eaves with a boxed cornice, a 2-bay porch with square posts, and a split-level brick foundation with basement entry on south side that is sheltered by a shed-roofed hood. A very tall, 2-story, rear brick wing on a full basement extends to the rear and has a side lean-to frame wing. The house is nearly identical to the one next door at 208 7th Street (104-0213-0087).



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1880** July 2006: This 2-story, 2-bay, side-passage-plan, gable-roofed brick building is laid in a 7-course American-with-Flemish bond on the front and 7-course American bond on the sides and rear. The building is two bays wide on the first floor and one bay wide at the second, with the window opening on the second floor lining up with the window on the first floor. The gabled roof is clad in standing-seam metal with an interior-end brick chimney, and the double-hung wood windows have 6/6-sash. Constructed ca. 1880, the house features a single transom over the door, overhanging eaves with a boxed cornice, and a split-level brick foundation. The 3-bay, full-width, shed-roofed front porch has square posts and a 3-rail balustrade. A 1-story, gable-roofed brick wing extends to the south. The 1-bay wing has an integral front porch that has been enclosed with weatherboarding. The house is nearly identical to the house located at 204 7th Street (104-213-0086), although this one has a side brick wing and an interior brick chimney.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:ShedContributingTotal:1



Primary Resource Information: Mixed:Commerce/Domestic, Stories 2.00, Style: Other, ca 1910

July 2006: Now used as a dwelling, this ca. 1910, 2-story, 3-bay, hip-roofed building appears to originally have been constructed as a mixed-use building: commercial on the first floor and residential on the second. Laid in 7-course American bond, the building has a standing-seam metal roof, segmental brick arches over the window openings, 2/2 and 6/6-sash windows, a plain frieze, overhanging eaves, and a boxed cornice. Originally, the first-floor front windows were larger and the openings have since been reduced in size and modern windows introduced into the space. The building has a second-story modern wood balcony with a hood covering the central door. Supported by wooden braces located directly above the first-floor door, this balcony provides some shelter for the first-floor opening beneath it.

Individual Resource Status: Mixed:Commerce/Domestic Contributing Total:1



Primary Resource Information: Single Dwelling, Stories 2.50, Style: Other, ca 1925 July 2006: This 2½-story, cube-shaped, 2-bay, hip-roofed American Foursquare was constructed ca. 1925. It is clad in aluminum siding, with modern single and paired 1/1-sash windows. The roof, with overhanging eaves, is covered in asphalt shingles and contains an oversized hip-roofed front dormer with paired windows and an interior brick chimney in the rear. The 3-bay, hip-roofed front porch has Tuscan column supports and plain pickets.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:GarageContributingTotal:1



Primary Resource Information: Single Dwelling, Stories 1.0, Style: Other, ca. 1955 July 2006: Constructed ca. 1955, this 1-story, 3-bay, gable-end dwelling is clad in stucco siding. The roof is covered in asphalt shingles and a 3-bay pedimented porch with square posts and a modern balustrade extends along half of the façade. It appears the house is now used as a duplex.



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Other, ca 1955 July 2006: Constructed ca. 1955, this 1½-story, 3-bay, gable-roofed, concrete block vernacular dwelling has two gable-roofed front dormers. The roof is covered in asphalt shingles and contains a central concrete bloc flue. The house has 1/1-sash wood windows, overhanging eaves, exposed rafter ends, a shed-roofed rear wing, and a 2-bay shed-roofed front porch with square posts and plain pickets.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 2006 July 2006: This 2-story, 5-bay, gable-end dwelling was constructed in 2006 by the Piedmont Housing Alliance. It is clad in Hardi-plank simulating weatherboard and the roof is covered in asphalt shingles. The 3-bay shed-roofed front porch is covered in standing-seam metal and has chamfered posts and plain pickets. The house has 2/2 and 4light windows and blends in well into the historic neighborhood despite its age. Individual Resource Status: Single Dwelling Non-Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.50, Style: Other, ca 1925 July 2006: This well-preserved, 2¹/₂-story, cube-shaped, 2-bay, hip-roofed American Foursquare was constructed ca. 1925. Clad in weatherboard siding with a plain friezeboard and corner boards, the house rests on a brick foundation and features a hipped roof clad in asphalt shingles with a hip-roofed front dormer. Other details include overhanging eaves, 2/2 and 6/6-sash windows, and a 3-bay front porch with Tuscan columns and plain pickets.

311 7th Street SW 104-0213-0003



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1925 July 2006: Constructed ca. 1925, this 1-story, 3-bay, gable-end dwelling has a brick veneer with a stuccoed, pedimented, front gable end. The roof is covered in asphalt shingles and the bricks laid in a stretcher bond pattern. The house has 4/1-sash wood windows, an interior concrete block flue, and 3-bay hip-roofed front porch with square posts and 3-rail balustrade.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1948 July 2006: Constructed ca. 1948, this 1-story, 3-bay, gable-end dwelling is clad in vinyl siding. The roof is covered in asphalt shingles and a 1-bay pedimented porch with square posts and 2-rail balustrade extends along half of the façade. The house has new 6/6-sash windows, a central concrete block flue, and asphalt shingles on the roof.

313 7th Street SW 104-0213-0094



Primary Resource Information: Single Dwelling, Stories 2.50, Style: Other, ca 1925
July 2006: This fairly well-preserved, 2½-story, cube-shaped, 3-bay, hip-roofed
American Foursquare was constructed ca. 1925. With its walls clad in stucco and its roof
covered in asphalt shingles, the house rests on a low parged foundation. Other details
include a hip-roofed front dormer with paired windows and overhanging eaves,
overhanging eaves, 6/1-sash windows (triple bay window under porch), a boxed cornice,
and small basement windows. The 2-bay, hip-roofed front porch has battered stuccoed
posts on stuccoed piers with a solid stuccoed balustrade. Individual Resource Status:
Single Dwelling Contributing Total: 1



Primary Resource Information: Commercial Building, Stories 2.50, Style: Other, ca 1940

July 2006: Constructed ca. 1940, this building, now used as a youth center, was originally constructed as a store. The 1-story, 3-bay, concrete block building has a shed roof with a stepped parapet along the front and side elevations. The building originally had larger storefront windows along the front but they have been removed and replaced with small 1/1 sash.

Individual Resource Status: Commercial Building Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 3-bay, 2-story, hip-roofed frame I-house features projecting 1-story polygonal bays on either side of the central entrance. The house rests on a raised parged foundation and has a standing-seam metal roof, and asbestos shingle siding. The windows, which have been replaced include 2/2-sash and single and paired 1/1 sash. This large house has overhanging eaves and a 1-bay front porch with square posts and a 3-rail balustrade. The front porch and side bays feature Mansard roofs of standing-seam metal. A 1-story wing extends to the rear.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This late-19th-century, 3-bay, 2-story frame I-house features a central-front gable, a brick foundation, asbestos siding, and a standing-seam metal hipped roof. The 2/2-sash windows are replacements, but the central brick chimney, pedimented front gable with round attic vent, overhanging eaves, and 2-light transom above the front door appear original. The 5-bay, hip-roofed front porch features turned spindles, sawn brackets, and a plain balustrade. The second-story, central-bay window on the façade features a paired 2/2 sash. The house features a rear 2-story hip-roofed ell with side and rear additions.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls have been stuccoed and the roof is covered in modern standing-seam metal with ridge vents. The 1/1 windows are replacements but the transom over the door, exterior parged brick chimney on the rear wall, and overhanging eaves are original. The 4-bay wraparound porch, supported by Tuscan columns, has plain pickets and wraps around the north side of the house to join the front section to a side/rear 2-story wing that contains a door out onto the porch. The house has a 1-story, hip-roofed rear and side wing with side porch.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style**: **Other**, **ca 1890** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls are clad in vinyl siding but the roof maintains its standing-seam metal covering. The 2/2-sash windows, 3-light transom and 3-light sidelights around the door, interior brick chimney with corbelled cap, and overhanging eaves are original. The 7-bay wraparound porch, supported by chamfered posts, has sawn brackets, a sawn balustrade, and is supported by a brick pier foundation with lattice infill. The house has a 1-story, gable-roofed side wing with enclosed front porch that is set back from the front section. A shed-roofed bay is located along the side of the main block and may provide access to a crawl space.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls are clad in vinyl siding and the roof in asphalt shingles. The 1/1 windows are modern but the 2-light transom over the door, exterior parged brick chimney on the rear wall, and overhanging eaves are original. A secondstory opening on the north side has closed shutters and may be a blind window. The 4bay wraparound porch is supported by chamfered posts with sawn brackets and a sawn balustrade and wraps around the north side of the house to join the front section to a side/rear 1-story wing that contains a door out onto the porch. The house has a 1-story, gable-roofed rear wing with numerous side lean-to additions.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, frame dwelling features a hipped roof with cross gables. The walls are clad in aluminum siding and the roof in asphalt shingles. Constructed ca. 1900, the house has a central parged flue, a brick foundation, 2/2-sash wood windows, overhanging eaves, a plain friezeboard, and gable end returns. A 1-story shed-roofed wing extends off the north side. The 2-bay, hip-roofed front porch has turned posts, sawn brackets and plain pickets.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, side-passage-plan frame dwelling features a hipped roof with a front cross gable. Constructed ca. 1890, the house has an exterior brick chimney on the rear wall, a standing-seam metal roof, vinyl siding, vinyl shutters, 2/2-sash wood windows, and a transom and sidelights around the front door. A 6-bay wrap around porch is supported by Tuscan columns and has turned balusters and a denticulated cornice. A 1story, gable-roofed frame wing extends to the rear and features a side porch with sawn balustrade.

Individual Resource Status: **Single Dwelling** Contributing *Total:*1 *Individual Resource Status:* **Shed** Contributing *Total:*1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls are clad in vinyl siding but the roof is covered in standing-seam metal and the house maintains original 2/2-sash windows, a transom over the door, a central brick chimney, and overhanging eaves. The 6-bay wraparound porch is supported by Tuscan columns and wraps around the north side of the house to join the front section to a rear wing that contains a door out onto the porch. The house has a 2-story rear wing on a raised basement and an attached shed-roofed garage wing on the south side.

Individual Resource Status: Single Dwelling Contributing Total:1 Individual Resource Status: Single Dwelling Non-Contributing Total:1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This late-19th-century, 3-bay, 2-story frame I-house features a central-front gable, a brick foundation, weatherboard siding, and an asphalt-shingled gabled roof. The 2/2-sash windows are replacements, but the two central brick chimneys, central-front gable with round attic vent, overhanging eaves, plain frieze, and 3-light transom and sidelights around the front door appear original. The 5-bay, hip-roofed front porch features Tuscan columns and a plain balustrade. A 1-story wing extends to the rear. Individual Resource Status: Single Dwelling Contributing Total: 1

Individual Resource Status:	Single D	weiling Contri	buung	10
Individual Resource Status:	Shed	Contributing	Total:	1
Individual Resource Status:	Garage	Contributing	Total:	1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1915** July 2006: This 2-story, 2-bay, hip-roofed vernacular brick side-passage-plan house was constructed ca. 1915. The brick walls are laid in 6-course American bond brick and a plain brick frieze that is painted white runs along the top of the walls. The house has 2/2sash windows, a transom over the door, a brick foundation, a central interior brick chimney, and overhanging eaves. The roof is covered in standing seam-metal. The 3-bay hip-roofed front porch has Tuscan column supports and turned balusters. A 1-story brick wing extends to the rear with a second-story frame addition and side 2-story frame wing to the wing.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: This 2-story, 2-bay, hip-roofed vernacular side-passage-plan house was constructed ca. 1915. The walls are covered in stucco and have a plain frieze beneath the overhanging eaves of the hipped roof that is clad in asphalt shingles. The house has 2/2sash windows, and a 3-bay hip-roofed front porch with Tuscan column supports and plain pickets. A 1-story brick wing extends to the rear.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890
July 2006: This late-19th-century, 2-story, 2-bay, vernacular side-passage-plan dwelling has a very tall, pedimented, gable-end front with paired attic windows. The house has stuccoed walls and an asphalt-shingled cross-gabled roof. The house has a plain frieze, 2/2-sash windows, gable-end returns, a 3-light transom and sidelights around the door, and a 3-bay front porch with Tuscan columns and plain pickets. A 2-story wing extends off the rear 2-story ell. The roof on this house may have been altered to its current configuration as it seems slightly out of proportion with the dimensions of the house. *Individual Resource Status:* Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900
July 2006: This 2-story, 3-bay, frame dwelling features a hipped roof with cross gables.
It was originally a side-passage-plan, 2-bay wide building, but an extra front door has been added, converting it into a duplex. Other alterations include a roof clad in asphalt shingles and walls covered in vinyl siding. Constructed ca. 1900, the house has a central interior brick chimney, a parged foundation, modern vinyl 2/2 windows, overhanging eaves, a plain friezeboard, and gable end returns. A 2-story wing on a concrete block foundation extends off the rear ell. The 3-bay, hip-roofed front porch has square supports. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 3-bay, frame dwelling features a hipped roof with cross gables. It was originally a side-passage-plan, 2-bay wide building, but an extra front door has been added, converting it into a duplex. Other alterations include a roof clad in asphalt shingles and walls covered in vinyl siding. Constructed ca. 1900, the house has a central interior brick chimney, a brick foundation, modern 1/1 windows, overhanging eaves, plain friezeboard, and gable end returns. The cross gables still retain pressed tin shingles in the gable ends as well as a round wooden attic vent. A 2-story wing extends off the rear ell. The 3-bay front porch has square supports and appears to have been screened at one time.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This turn-of-the-century, 2-story, 2-bay vernacular frame dwelling is currently under renovation. It is a single-pile, side-passage plan and is clad in weatherboard siding although vinyl siding is currently being installed. The hipped roof is covered with asphalt shingles and has overhanging eaves, a plain frieze, and an exterior brick chimney along the rear elevation. Some of the original 2/2-sash windows are still visible although most have been replaced with modern 1/1-sash. A 1-story, gable-roofed frame wing extends to the rear and has original weatherboard siding, gable-end returns, and a side-lean to wing. The front 4-bay porch has square posts on wood piers and a modern balustrade. It extends one bay south of the main block to take in part of a side 1story, 1-bay wing.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Late Victorian, ca 1897

July 2006: Constructed in 1897, this 2-story, 3-bay, brick, vernacular I-house features some Victorian decorative elements. The hip-roofed house has a standing-seam metal roof and the brick walls are laid in a 6-course-American-bond pattern. The house has not been greatly altered and includes: 2/2-sash wood windows with wooden sills and molded surrounds, a double-leaf, wood and glass front door comprised of a tall pane of glass surrounded by small panes of stained glass; a 2-light transom above the doors; a plain brick frieze; two central interior brick chimneys with corbelled caps; a round stained-glass window on the second-floor, center bay of the rear elevation; and a 1-story, hip-roofed, rear brick wing with two interior chimneys and a plain brick frieze. The 3-bay, hip-roofed front porch has turned posts, a wooden floor, and no balustrade.

Individual Resource Status:Single Dwelling ContributingTotal:1Individual Resource Status:ShedContributingTotal:1



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1925

July 2006: Constructed ca. 1925, this 1 $\frac{1}{2}$ -story, 3-bay, gable-end, brick dwelling is a vernacular interpretation of the Craftsman Bungalow style. The walls are laid in stretcher bond brick, the roof is clad in asphalt shingles, and the house contains exposed rafter ends, overhanging eaves, and 1/1-sash windows. The 1-bay, integral, full-span, front porch has a pedimented gable end containing asphalt shingles and a round wooden attic vent. The porch, supported by square posts located at the outer corners, has a brick floor.

420 7½ Street SW 104-0220 Other DHR Id #: 104-0213-0055



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Colonial Revival, ca 1910

July 2006: This 2-story, 3-bay, double-pile, hip-roofed vernacular brick dwelling appears to have been constructed ca. 1910 and contains architectural elements of the Colonial Revival style. The walls are laid in 5-course American bond, which is rare for a post-bellum building and is usually seen on ones from the first half of the 19th century. The roof is clad in asphalt shingles and there is no evidence of a chimney. A plain brick frieze that has been painted white is protected by the overhanging eaves. The 1/1-sash windows appear to be modern replacements. The front door has a transom above whereas the sidelights have been enclosed. A 3-bay, hip-roofed front porch has square brick posts on brick piers and a low brick wall. A side 1-story, 1-bay, gable-roofed, brick ell extends to the south.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:ShedContributingTotal:1

501 7½ Street SW 104-0223 Other DHR Id #: 104-0213-0060



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1915 July 2006: This 2-story, 2-bay, double-pile, hip-roofed vernacular brick dwelling appears to have been constructed ca. 1915. The brick walls are laid in stretcher bond and the 2bay façade features off-center openings. The hipped roof is clad in standing-seam metal and contains an interior brick chimney. Other details include overhanging eaves, a boxed cornice, 2/2-sash windows, a 3-bay hip-roofed front porch with tapered square posts on wooden piers, and a rear gable-roofed screened-in porch.

509 7¹/₂ Street SW 104-0213-0061



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 3-bay, hip-roofed vernacular brick I-house was constructed ca. 1900. The brick walls are laid in 6-course American bond brick and the 2/2-sash windows have brick segmental arches on the first floor. The double-leaf, wood and glass front door has a 3-light transom. Other details include a plain brick frieze, two central interior brick chimneys with corbelled caps, a split–level foundation, and 2-story rear addition flanked by 1-story wings. The 3-bay, gable-roofed front porch has square posts on low piers and a segmental arch in the pediment.

Individual Resource Status: Single Dwelling



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style**: **Other**, **ca 1900** July 2006: This 2-story, 2-bay, frame, hip-roofed vernacular dwelling rests on a brick foundation. Constructed ca. 1900, it is two bays wide on the first floor and one-bay wide at the second, with the window opening on the second floor directly above the window on the first floor. The hipped roof is clad in asphalt shingles with no visible chimney, and the double-hung wood windows have 6/6-sash. The house features overhanging eaves, a split-level foundation, a 2-bay hip-roofed front porch with turned posts and plain pickets, and rear 1-story shed-roofed wing.

Individual Resource Status: Single Dwelling

515 7½ Street SW 104-0213-0063



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1900

July 2006: This 2-story, 4-bay, gable-roofed vernacular I-house features two front doors and may have been constructed as a duplex. The house, clad in weatherboard siding, has a gabled roof with a central-front gable that is covered in standing-seam metal. An exterior brick chimney is located on the south gable end while an interior brick flue is located on the north gable end. Other details include a parged foundation, 6/6-sash windows, gable-end returns, a plain friezeboard, corner boards, 6/6-sash windows, and a rear 1-story hip-roofed wing with central brick chimney. The 3-bay, front porch has chamfered posts and a low Mansard roof.

Individual Resource Status: Multiple dwelling



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: Constructed ca. 1890, this 2-story, 2-bay, cross-gabled, vernacular frame dwelling is clad in weatherboard siding and has a standing-seam metal roof. Other details include plain frieze board, overhanging eaves, corner boards, stone foundation, and round attic vent in the gable ends. The 1/1-sash vinyl windows, louvered vinyl shutters, and steel front door are modern alterations.



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1925

July 2006: This 1½-story, 3-bay, frame bungalow has a gable roof with a large gabled front dormer with weatherboard siding and three windows. Constructed ca. 1930, the house features a split level concrete foundation, bricktex siding, asphalt shingle roofing, interior brick chimney, overhanging eaves with exposed rafter and purlin ends, 4/1 windows, and a 3-bay gabled porch with battered wood columns on brick piers. *Individual Resource Status:* Single Dwelling Contributing *Total:* 1

223 9th Street SW 104-0213-0043



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, hip and cross-gable-roofed, side-passage-plan, frame dwelling features a hipped roof with cross gables and was constructed ca. 1890. The house rests on a brick foundation and features a central brick chimney, standing-seam metal roofing, weatherboard siding, 1/1-sash windows, a plain frieze, wood shingles and round attic vents in the gable end, gable-end returns, a double-leaf front door with singlelight transom, and a rear 1-story hip-roofed wing. The 5-bay wraparound front porch features turned spindles, turned balusters, sawn brackets, and a Mansard roof. *Individual Resource Status:* Single Dwelling Contributing Total: 1




Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1885 July 2006: This 2-story, 2-bay, cross-gabled, frame vernacular dwelling with many Victorian details was constructed in 1885 by Jacob H. Nalls, a local building contractor. Clad in vinyl siding over the original German-lap siding, which is visible under the front porch, the house has a roof of standing seam metal. The house features a projecting front bay under the front porch and a projecting rectangular bay off the rear ell. Resting on a brick foundation, the house has interior brick chimneys with corbelled caps. The 2/2-sash vinyl windows are modern replacements. The 6-bay front porch, supported by turned posts, has segmental-arched bays that are formed by the double pierced two-stage frieze with Eastlake-style detailing. The bays of the porch around the bay window make a semioctagonal projection around the bay window. A small second-story gabled pavilion that appears to be a later addition is set on the roof of the porch over the entrance bay. Other details include pressed tin shingles in the front pedimented gable end, a plain bracketed frieze, and a modern front door. The rear 2-story wing has enclosed side porches and a rear 1-story lean to. The house is now used as offices for Dogwood Housing Ltd., who purchased the property in 1980.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Single Dwelling Non-Contributing Total: 1

- 116 -



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, hip and cross-gable-roofed, side-passage-plan, frame dwelling features a hipped roof with cross gables and was constructed ca. 1890. The house rests on a parged brick foundation and features a central parged chimney, asphalt shingle roofing, aluminum siding, 1/1-sash windows, a plain frieze, gable-end returns, a 2-story rear wing and a rear 1-story gable-roofed wing with enclosed side porch. The 3-bay, hip-roofed front porch is supported by square posts.

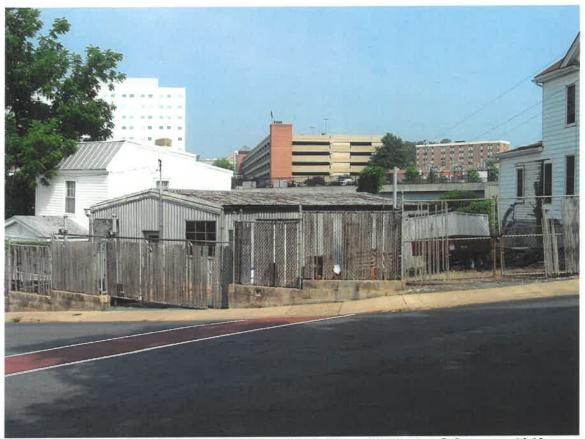

Primary Resource Information: Warehouse, Stories 1.00, Style: Other, ca 1940 July 2006: This 1-story, 3-bay, gable-end, frame storage building is clad in corrugated metal roofing and siding and contains a garage door and steel 9-light windows. It appears to have been constructed ca. 1940 on the site of the former Fife Chapel.

Individual Resource Status: Warehouse Contributing Total: 1



Primary Resource Information: Multiple dwelling, Stories 3.00, Style: Other, ca 1991

July 2006: This 3-story, modern vernacular, brick building with 3 front-facing cross gables was constructed in 1991 and is the Ronald McDonald House, a place where parents of children that are in a hospital can stay at night. It is constructed on the site of the Moore-Wingfield House, a fine Victorian dwelling constructed in 1885.

Individual Resource Status: Multiple dwelling Non-Contributing otal: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1886
July 2006: This 2-story, 2-bay, gable-end, vernacular frame dwelling was constructed ca.
1886 by Mrs. Lena King. The house rests on a brick foundation and has weatherboard siding and a standing-seam metal roof. Architectural details include gable-end returns, plain friezeboard, corner boards, a rectangular attic vent, 3-light transom, and a 1-story, 1-bay, hip-roofed side wing that extends past the rear of the main block of the house.
Modern 1/1-sash windows replaced the original 6/6-sash. The 3-bay hip-roofed front porch has turned posts and plain pickets and incorporates a modern handicap ramp. *Individual Resource Status:* Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1925 July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling appears to have been constructed ca. 1925. It is clad in aluminum siding, rests on a brick foundation, and has a standing-seam metal roof. Architectural details include a central brick chimney, split-level foundation, overhanging eaves, exposed rafter ends, 6/1- and 6/6-sash windows, a single transom over the 6-paneled door, and a 3-bay hip-roofed front porch with battered square posts and exposed rafter ends. To the rear is a 1-story porch and modern 2-story decks.

Individual Resource Status: Single Dwelling



Primary Resource Information: Commercial Building, Stories 1.00, Style: Other, ca 1969

July 2006: This 1-story, cross-gabled, 5-bay, brick, vernacular commercial building was constructed in 1969. The building rests on a concrete foundation with stretcher-bond brick walls, and has an asphalt shingle roof, multiple garage doors, and vinyl siding in the gable ends.

Individual Resource Status: Commercial Building Non-Contributing Total:1

415 9th Street SW 104-0213-0049




Primary Resource Information: Commercial Building, Stories 1.00, Style: Other, ca 1950

July 2006: Constructed in 1950 with additions in 1952-53, this 1-story, 4-bay, gableroofed, vernacular commercial building is constructed of concrete block. The roof, which has deeply overhanging eaves on the front, is clad in asphalt shingle. The southern end of the building is the oldest and contains full plate-glass windows and a corner window.

Individual Resource Status: Commercial Building Contributing Total: 1

*501 9th Street SW 104-0031 Other DHR Id #: 104-0213-0050

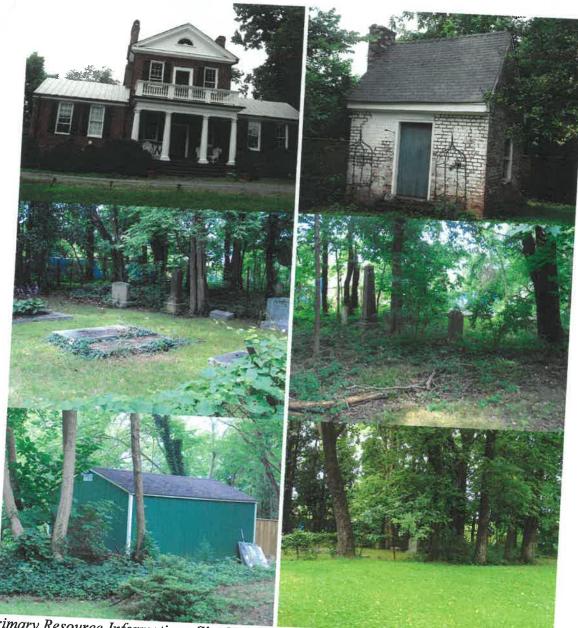

Primary Resource Information: Single Dwelling, Stories 2.00, Style: Early Classical Revival, 1822

July 2006: Constructed in 1822, this 2-story, three-part brick dwelling is an accomplished example of Jeffersonian Palladianism and was constructed by builders who worked for Jefferson on the academic village at the University of Virginia. James Dinsmore, a Scots-Irish builder who worked for Jefferson, is believed to have designed the house and also worked on its construction. The house is comprised of a 2-story, 3-bay, gable-end central brick block flanked by slightly recessed, 1-story, 2-bay brick

wings with side gable roofs. The brick walls are laid in Flemish bond above a water table of 3-course American bond with molded quarter-round bricks. The roofs are clad in

standing-seam metal. Exterior brick chimneys are located between the main block and each of the side wings. An additional interior brick chimney is located at the west end of the main block. The 1-story, 3-bay front portico with Tuscan-column supports and a plain entablature, has a flat roof with a wooden railing of turned balusters. Other details include 9/6- and 9/9-sash wood windows with louvered wooden shutters, a boxed cornice, a lunette window in the front pedimented gable-end, a 6-panel front door, two square 4-light attic windows in the west gable end, and a large glassed-in rear 1-story wing constructed in 1998. The property is listed on the National Register of Historic Places.

Individual Resource Status:	Kitchen Contri	buting <i>Total</i> :	1	
Individual Resource Status:	Single Dwelling	Contributing	Total:	1
Individual Resource Status:	Cemetery	Contributing	Total:	1
Individual Resource Status:	Cemetery	Contributing	Total:	1
Individual Resource Status:	Shed Non-C	Contributing	Total:	1

Inventory of Historic Resources in

FIFEVILLE-CASTLE HILL HISTORIC DISTRICT CHARLOTTESVILLE, VIRGINIA



Part 2: Cherry Avenue – Spring Street



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1900** July 2006: This 2-story, 3-bay frame I-house features a central-front gable, a brick pier foundation with infill, a standing-seam metal roof, and T-111 siding over the original weatherboard siding that is still evident in the front gable end and the rear of the house. It appears that the 2/2-sash windows on the first floor are replacement windows while the second-story ones are original. Other architectural details include a 2-light transom over the front door, an exterior-side brick chimney on the rear gable, and a 3-bay hip-roofed front porch with square posts, sawn brackets, and turned balusters. To the rear is a 1-story, gable-roofed frame wing.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Shed Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Other, ca 1925 July 2006: This 1 ½-story, 2-bay, vernacular, gable-roofed frame cottage has a small shed-roofed front dormer with 6-light windows, an exterior-end brick chimney, overhanging eaves, 6/6-sash windows, and paneled wooden shutters pierced with the silhouette of a pine tree. The entrance is located in the southwest corner of the house, under the recessed porch that is fronted by a 1-bay pedimented portico supported by square posts. To the side is a shed-roofed second-story wing supported by posts. To the rear is a shed-roofed 1-story wing. The house is clad in vinyl siding and the roof covered in asphalt shingles.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Garage Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1950 July 2006: This 1-story, 3-bay, vernacular frame dwelling was constructed ca. 1950 and features asbestos siding, a gabled roof clad in asphalt shingle, and a pedimented 2-bay front porch with square posts and plain pickets. The split level foundation is of concrete block and no chimney was visible.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 3-bay, 2-story, gable-roofed, ca. 1900, frame I-house features a 2-story projecting central-front gable and rests on a parged foundation. The gable-end returns, 4light transom and 3-light sidelights around the front door, and the 5-bay front porch with turned posts, plain balusters, and sawn brackets appear original. The 6/6 vinyl windows are replacements as is the vinyl siding, and asphalt shingle roof.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Garage Non-Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Gothic Revival, ca 1891

July 2006: Constructed ca. 1891, this 1-story, L-shaped frame dwelling features some Gothic Revival-style detailing. Originally clad in weatherboard, the exterior walls are now covered in asbestos shingle and the cross-gabled roof in asphalt shingle. The house has steeply pitched roofs with deeply overhanging eaves and a plain frieze and a large central parged chimney. A pointed-arched attic vent is located in each of the cross gables. The original 4/1 sash windows are intact except in the front cross gable where one has been replaced with a single-light sash. A 2-bay wraparound porch with square posts and plain pickets leads to the front entrance door. To the rear is a 1-story gable-roofed wing and shed-roofed wings that are on raised foundations due to the sloped rear yard.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay hip-roofed, frame dwelling features a central brick chimney, a parged foundation, a standing-seam metal roof, a transom over the door, and an enclosed 3-bay front porch with Tuscan columns and turned balusters. Constructed ca. 1900, the building is now clad in aluminum siding and has replacement vinyl 2/2 windows. A frame wing extends to the rear.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Garage Non-Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 3-bay, 2-story, hip-roofed, frame I-house features a central-front gable, brick foundation, weatherboard siding and an asphalt shingle roof. The gable-end returns, 2-light transom over the double-leaf door, large interior brick chimney, overhanging eaves with plain frieze, rectangular attic vent, and 3-bay hip-roofed front porch with Ionic columns and denticulated cornice, all appear to be original. To the rear is a 2-story hiproofed ell and 1-story enclosed porch.



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1980

July 2006: This apartment duplex, constructed in 1980, is a 2-story, 3-bay, gable-roofed building with a rear 2-story wing. Clad in unpainted wood siding and roofed in asphalt shingle, it has 1/1 wood windows, a 1-bay hip-roofed front porch with square posts, and a rear two-story ell with a recessed side entry.

Individual Resource Status: Multiple dwelling Non-Contributing Total: 1

1001, 1003 Cherry Avenue 104-0213-0268



Primary Resource Information: Apartment Building, Stories 2.00, Style: Other, ca 1981

July 2006: This apartment complex, constructed in 1981, is made up of two, 2-story frame apartment buildings with weatherboard siding, paired 6/1 windows, and a catslide gable roof clad in asphalt shingle. Each has a two-story deck out onto a common green area.

Individual Resource Status: Apartment Building Non-Contributing Total:1 Individual Resource Status: Apartment Building Non-Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This turn-of-the-century, 2-story, 2-bay, gable-roofed frame vernacular dwelling has a central door with an enclosed transom and 2-light sidelights. The house is clad in weatherboard siding and features a plain bracketed frieze, a standing-seam metal roof, and an exterior brick chimney on the rear gable side. The 6/6 vinyl windows are modern replacements, one of the second-floor windows has been enclosed, and one bay of the 3-bay front porch with chamfered posts, denticulated cornice and sawn balustrade and brackets has been enclosed. To the rear is 1-story gable-roofed wing with interior brick flue.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, frame vernacular dwelling has a cross-gabled roof clad in standing-seam metal. The walls are covered in vinyl siding and the 6/6 vinyl windows, louvered shutters and front door with sidelights are new. Architectural details include a parged foundation, an exterior side brick chimney, gable-end returns, and 2-bay hiproofed front porch with turned posts. To the rear is 1-story gable-roofed wing with interior brick flue.

Individual Resource Status: Single Dwelling Contributing *Total:* 1 *Individual Resource Status:* Shed Non-Contributing *Total:* 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 2-story, 3-bay, frame vernacular dwelling features Victorian elements, a shallow Mansard roof, and a 2-story projecting polygonal bay on the end bay of the front façade. The house, clad in asbestos shingle, has a parged foundation, an interior parged brick chimney, 2/2-sash windows, standing-seam metal and asphalt shingle roofing, and a 4-light transom and 3-light sidelights around the front door. The bracketed wood cornice contains pendants and the 4-bay hip-roofed front porch has turned posts supports. The house extends to the rear with a shed-roofed 1-story wing on a raised foundation.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1971 July 2006: Constructed ca. 1960, this 1-story, 3-bay, gable-end concrete block dwelling features steel 4 x4 windows, a central concrete block flue and aluminum siding in the gable end. It is fronted by a 3-bay shed-roofed porch with square posts and a 2-rail balustrade.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1960 July 2006: Constructed ca. 1960, this 1-story, 3-bay, gable-roofed, frame dwelling is clad in weatherboard siding. The original 1-bay gabled front porch has been expanded to three bays with a shed roof, square posts and lattice in the bays. Details include asphalt shingle roof, sliding casement windows, and a central concrete block flue.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This late-19th-century, 2-story, 2-bay, hip-roofed vernacular dwelling is stuccoed. It features overhanging eaves, and exterior-end brick chimney (fairly modern), a pedimented 1-bay front porch with square posts, and a 1-bay hip-roofed side porch. Some of the single and paired 6/6- and 8/8-sash windows and bay window are replacements. A 1-story shed-roofed wing extends to the rear.



Primary Resource Information: Mixed:Commerce/Domestic, Stories 2.00, Style: Other, ca 1961

July 2006: Constructed ca. 1961, this 2-story, 2-bay, gable-end, cinder block building has a commercial (office) use on the first floor and a residential use (two apartments) on the second. A set of metal exterior stairs leads up to the second-story apartments that are fronted with a shed-roofed porch. The gable-end roof is clad in asphalt shingle with board-and-batten in the gable end, and the masonry walls are parged. A three-part bay window is located on the front while the rest of the windows are horizontal 1/1-sash windows. A garage door is located at the northwest, 1st-floor corner of the building. *Individual Resource Status:* Mixed:Commerce/Domestic Non-Contributing Total:1

318 Dice Street 104-0213-0192



Primary Resource Information: Multiple dwelling, Stories 1.00, Style: Other, ca 1925

July 2006: Constructed ca. 1925, this 1-story, 6-bay, stuccoed frame, vernacular duplex is sited perpendicular to the road. It features a hipped roof of asphalt shingle; overhanging eaves with exposed rafter ends; a central brick chimney, 1/1-horizontal wood windows, and a 3-bay shed-roofed front porch with square posts.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1853 July 2006: This 2-story, 3-bay, brick I-house with a central-front gable is believed to have been constructed ca. 1850, although some of the architectural features suggest a post-Civil War construction date. It is believed to have been one of several dwellings in the area constructed by master builder, Allen Hawkins, whose own house was on 5th Street SW. The front of the gable-roofed dwelling is laid in Flemish-bond brick, while the rear and sides are laid in a 7-course American bond with Flemish bond. The house appears to have been repointed as the mortar joints are very prominent. The foundation is parged, the roof covered in standing-seam metal, and the house features modern 2/2-sash windows (paired in 2nd-story central bay), a 4-light transom and sidelight around the front door, overhanging eaves with a plain bracketed frieze, 2 interior-end brick chimneys, and gable-end returns. The 3-bay, Colonial Revival-style front porch has Tuscan columns and a concrete floor (ca.1979). To the rear is a 1-story brick wing, laid in 8-course American bond with Flemish bond. This service wing has a mousetooth cornice, modern 2/2-sash windows, and a gabled metal roof. A modern 1-story, gable-roofed, stuccoed addition extends south of the rear wing.

Individual Resource Status: Single Dwelling Contributing *Total:* 1 *Individual Resource Status:* Shed Non-Contributing *Total:* 1



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1935

July 2006: Constructed ca. 1935, this well-preserved 1 ½-story, 3-bay, stuccoed bungalow features a gable-end roof line with a 1-bay gable-end front porch. The 1-bay front porch has is supported by battered stuccoed piers on a solid balustrade that extends the entire width of the house. The house rests on a parged foundation and features overhanging eaves with exposed rafter ends, an exterior-side brick chimney that breaks through the eaves, 10/1 Prairie-sash windows on the front; a Craftsman-style front door, paired 6/1 sash windows on the sides of the house, an attic window in the front gable end, and an interior brick flue.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: Constructed ca. 1890, this large, 2-story, 3-bay, stuccoed frame vernacular dwelling with a cross-gable-roofed, features a large 2-story hip-roofed stuccoed addition on the side/rear. Architectural details include a plain friezeboard with turned vergeboard, a 3-light transom over modern front door, 2/2-sash vinyl windows, round attic vents in the gable ends, a parged foundation, and a fine 8-bay wraparound porch with turned posts, turned spindles, and a spindle frieze.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Gothic Revival, ca 1874

July 2006: This 2-story, 2-bay, Vernacular Gothic Revival-style frame dwelling was constructed in 1874. The two bays are not centered within the façade, while the prominent central front gable is, giving the building an interesting appearance. The well preserved house has weatherboard siding, a brick pier with infill foundation that has been parged, 6/6-sash wood windows, a central brick flue, a plain friezeboard, overhanging eaves, and a modern front door. To the rear is a 2-story gable-roofed ell and one-story addition. The second-story front windows feature gabled window crowns supported by brackets. The 3-bay front porch has a shallow Mansard roof, turned posts and plain pickets and may have been remodeled as it covers the first-floor window and door hoods.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: This ca. 1910, 2-story, 2-bay, hip-roofed, vernacular frame dwelling features an asphalt shingle roof, overhanging eaves, 4/1 windows (some with aluminum awnings), a brick foundation, aluminum siding, an enclosed rear porch, 5-light sidelights around the front door, and a 3-bay front porch with Tuscan column supports and aluminum awnings.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Garage Non-Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1875 July 2006: The original ca. 1875, section of this dwelling is the 2-story, 2-bay, sidepassage-plan portion. The recessed 2-story, 1-bay side wing was constructed ca. 1877, giving it a 3-bay, center-passage form that is united by the 3-bay hip-roofed front porch with turned posts and plain pickets. The house has a gable roof of asphalt shingle, weatherboard siding, a parged stone and concrete foundation, 6/6-sash windows, 2 central brick flues with corbelled caps, overhanging eaves, and a rear 1-story wing.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style**: **Other**, **ca 1880** July 2006: This late-19th-century, 2-story, 2-bay, side-passage-plan, vernacular dwelling features a gabled roof with central-front gable. The house appears to have been remodeled fairly recently when the siding was replaced with Hardi-Plank, the roofing with asphalt shingle, the windows with vinyl 6/6-sash, and the wooden front door with a metal one. The house features a projecting bay on the first floor with three large 6/6-sash vinyl windows, a brick pier foundation with stone infill, and a 2-bay front porch with turned posts and plain pickets.

412 ¹/₂ Dice Street 104-0213-0195



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 2006 July 2006: Constructed ca. 2006, this narrow and long, 2-story, 2-bay, modern dwelling features a half-hyperbolic roof, siding made up of large rectangular panels, exposed rafter ends, full-light double-leaf French doors, narrow fixed single-light windows with transom, parapet walls along the side roofline, and a rear deck.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a cross-gabled roof with a front cross gable and was constructed ca. 1890. The frame house appears to have recently been remodeled. It features Hardi-plank siding, modern vinyl 6/6-sash windows, a new front door, new turned spindles on the 2-bay hip-roofed front porch, rear 2-story wing, and modern asphalt shingle roofing. The gable-end returns and parged foundation are original.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1894** July 2006: This ca. 1894, 2-story, 3-bay, side-passage-plan, vernacular dwelling features a shed roof with a parapet with central front gable and a bracketed cornice. The house, which rests on a parged foundation, is clad in stucco on the first floor beneath the porch and board-and-batten siding on the rest of the exterior wall. The windows are 2/2-sash, and the house features a standing-seam metal roof, an enclosed transom over the door, 6/6 windows in the rear, and a 3-bay hip-roofed front porch with square supports and plain pickets.



Primary Resource Information: Slave Quarters, Stories 2.00, Style: Other, ca 1895 July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a crossgabled roof with a front cross gable and was constructed ca. 1895. The frame house, currently undergoing rehabilitation, is clad in stucco and features a standing-seam metal roof, gable-end returns, a stuccoed foundation, 1/1-sash vinyl replacement windows, a modern front door, and a rear 2-story ell with side addition. The 2-bay hip-roofed front porch, now with square posts, 4-rail balustrade, and asphalt shingle roofing, originally had turned posts supports as evidenced by the turned pilaster near the front door. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Vernacular Greek Revival, ca 1860

July 2006: Currently under restoration, this house was constructed in 1860 and is a vernacular interpretation of the Greek Revival style. The 2-story, 3-bay, hip-roofed frame I-house rests on a full brick basement laid in 7-course American bond. The walls are clad in weatherboard with a plain frieze and cornerboards, and the shallow-pitched roof is covered in standing-seam metal. The wood windows, including the ones in the basement level, vary in size based on their location and, although modern, have 6/6- double-hung sash. An exterior brick chimney is located at each end: the one on the north is original and has been partially parged, while the one on the south end has recently been rebuilt. Both chimney stacks pierce the eaves of the building. The original front of the house faces west and features 4-ligth sidelights around the 4-paneled front door. The 1-bay pedimented portico in front of the entrance is supported by Tuscan columns with plain pickets and a wooden stair. Above it on the second floor is a small 6-light window. The house was originally 1½ stories in height.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling features pedimented front and side gables. Resting on a parged solid foundation, the house is clad in aluminum siding and the roof in asphalt shingle. The house has a 2-story hip-roofed side/rear wing that gives the house an L-shaped configuration. An enclosed one-story three-bay porch is located in the inner angle of the L. Because of the sloped site, the split-level foundation is well above grade on the east side of the house and contains paired 6/6-sash windows and modern basement windows along the north. Other details include 2/2-sash windows, rectangular attic vents in the gable ends, a 2-light transom over the front door, and a bracketed bonnet hood supported by brackets over the front door.

<image>

Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a cross-gabled roof and was constructed ca. 1910. The frame house is clad in asbestos shingle and features a standing-seam metal roof, gable-end returns, a brick foundation, a round attic vent, 1/1-sash windows and a 3-bay hip-roofed front porch with Tuscan columns that rest on brick piers and a balustrade comprised of staggered bricks. A 2-story ell extends to the rear and includes enclosed side 2-story porches, two 1-story shed-roofed wings, and a modern rear deck.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Single Dwelling Non-Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.50, Style: Other, ca 1910 July 2006: This 2½-story, 4-bay, stuccoed, frame vernacular dwelling currently has two front doors, one of which appears to have been added. A variation on the American Foursquare form, the early-20th-century house features a hipped roof with two central corbelled brick chimneys, hipped dormers on the front and side elevation both with 6/6sash windows, and overhanging eaves. The plain wooden frieze, 2/2-sash windows, and 6-bay wraparound porch with Tuscan columns and solid tongue-and-groove wood balustrade appear original. The southeast corner of the house contains a bank of 6/6-sash windows that suggest either a sleeping porch or an enclosed integral porch. A rear 2-story wing extends to the rear and contains a garage bay on the first floor end bay and 2-story side porches.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910
July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a hipped roof with a front cross gable and was constructed ca. 1910. The frame house is clad in vinyl siding and features asphalt shingle roofing, gable-end returns, a brick foundation, 1/1-sash vinyl replacement windows, and a 3-bay hip-roofed screened-in front porch with turned posts. A 2-story ell extends to the rear as well as a 1-story shed-roofed wing. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910
July 2006: This 2-story, 2-bay, side-passage-plan, vernacular dwelling features a hipped roof with cross gables and was constructed ca. 1910. The brick house is clad in stucco and features a plain friezeboard, stuccoed foundation, central parged brick flue, 2/2-sash windows, round wooden attic vent, 2-light transom over door, and gable-end returns. The 3-bay front porch features a hipped roof supported by turned posts, with spindle brackets. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1930

July 2006: This 1½-story, 2-bay stuccoed bungalow features a clipped gable-end roof line with jerkinhead dormers on the side elevations. The 2-bay front porch has a bellcast Mansard roof and one open segmental-arched bay supported by battered posts on piers. The other bay is enclosed by a bank of four 6/1-sash windows with a masonry window plant box supported by three brackets. The long and fairly narrow house, constructed a. 1930 rests on a cinder block foundation, with 3-light basement windows, and a roof clad in asphalt shingles. The deeply projecting eaves are boxed and the dormers give the impression of half-timbering in the wall treatment. An exterior parged chimney that pierces through the eaves is located along the west side of the house. The single, paired, and triple wood windows are 6/1 sash with the upper sash shorter than the lower sash. The front porch has a stuccoed balustrade and a tiled floor.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Garage Contributing Total: 1

- 160 -

TYPE 10



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1963 July 2006: Constructed in 1963, this 1-story, 3-bay, gable-roofed vernacular dwelling is constructed of concrete block. The roof is clad in asphalt shingle as is the 1-bay shedroofed front porch with square posts. The single and paired wood windows are vertical 1/1-sash.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1910** July 2006: This extremely well-preserved, 2-story, 2-bay, side-passage-plan, brick dwelling features a hipped roof with cross gables and was constructed ca.1910. The house is laid in 6-course American bond and features a plain brick frieze (like found on other brick houses on 7th Street), gable-end returns, 2/2-sash windows, asphalt shingle roofing, interior flue, overhanging eaves, a transom over the front door, rear shed-roofed porch, and an enclosed shed-roofed basement entry. The fine 3-bay front porch features a hipped roof supported by turned posts, with spindle brackets and plain pickets.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:ShedContributingTotal:1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: This ca. 1910, 3-bay, 2-story, frame I-house features a central-front pedimented gable, stucco siding, standing-seam metal roofing split-level parged foundation, a central parged flue, slightly overhanging eaves, and a rear 2-story ell with an enclosed 2nd-story side porch. The 3-bayfront porch has turned spindles and modern handrail. The windows and doors have been plyboarded, apparently due to a fire.



Primary Resource Information: **Single Dwelling**, **Stories 1.00**, **Style: Other, ca 1881** July 2006: The easternmost three bays of this telescopic, 1-story, stuccoed vernacular dwelling is the original and features a steeply-pitched gable roof with overhanging eaves, 2/2 aluminum windows, a 1-bay pedimented porch, and an exterior-end stuccoed brickchimney. Constructed ca. 1881, this section has a 1-story, 2-bay gable-roofed wing that projects from its western end. Probably dating to ca. 1900, this section also has aluminum, 2/2-sash windows that match those in the main block. A smaller, more modern, 1-story, 2-bay, hip-roofed stuccoed frame wing extends even further to the west and also features 2/2-sash aluminum windows but of a different size. All walls of this frame building are clad in stucco and the roof in asphalt shingle. *Individual Resource Status:* **Single Dwelling** Contributing *Total:* 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This ca. 1890, 3-bay, 2-story, frame I-house features a central-front gable, stucco siding, gable-end returns, a transom over the front door, a plain frieze board, 2/2-sash windows, and a rear 2-story wing. The 3-bay front porch has Tuscan columns supports and no balustrade.

Individual Resource Status:	Single D	welling Contributing	Total:	1
Individual Resource Status:	Shed	Non-Contributing	Total:	1
Individual Resource Status:	Shed	Non-Contributing	Total:	1



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1984 July 2006: Constructed in 1984, this 1-story, 3-bay, vernacular frame dwelling is clad in aluminum siding and has a gable roof covered in asphalt shingle. The single and paired windows are 8/8 sash and the house has an exterior-end concrete block flue, split-level foundation, and front entrance deck.

Individual Resource Status:Single Dwelling Non-ContributingTotal: 1Individual Resource Status:Single Dwelling Non-ContributingTotal: 1

Elm Street 104-0213-0051 Other DHR Id #: 44AB0527



Primary Resource Information: Archaeological Site, December 2006: Site was visited in Dec. 2006 and portions walked. Substantial piles of brick and other debris were noted but no artifacts were collected. A Sanborn Insurance Map was used to locate former structural features. The site is currently abandoned and grown over in trees and underbrush. A small drainage runs through the west portion of the site. Large mounds of architectural debris (brick, etc.) litter the site.

Individual Resource Status: Archaeological Site Contributing Total: 1



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1895

July 2006: This 2-story, 2-bay, hip-roofed duplex features a central-cross gable that has been divided by a modern, vertical, concrete block fire wall that has been constructed between the two halves of the building, presumably in order to meet modern fire code. This wall has a parapet roof that extends above the roof line of the building and also projects from the front wall. Each of the apartments has a side entrance with its own 6-bay wraparound porch with square posts. The building, constructed ca. 1895, has been remodeled and is now clad in vinyl siding, with a roof covered in asphalt shingles. The 1/1-sash windows and rear decks are also not original.

Individual Resource Status: Multiple dwelling

Contributing Total: 1

838, 840 Estes Street 104-0213-0053



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1895

July 2006: This 2-story, 2-bay, hip-roofed duplex features a central-cross gable that has been divided by a modern, vertical, concrete block fire wall that has been constructed between the two halves of the building, presumably in order to meet modern fire code. This wall has a parapet roof that extends above the roof line of the building and also projects from the front wall. Each of the apartments has a side entrance with its own 6-bay wraparound porch with square posts. The building, constructed ca. 1895, has been remodeled and is now clad in vinyl siding, with a roof covered in asphalt shingles. The 1/1-sash windows and rear decks are also not original.

Individual Resource Status: Multiple dwelling

Contributing Total: 1

846 Estes Street 104-0213-0052



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 2-story, 2-bay, hip and cross-gable-roofed, side-passage-plan, frame dwelling features a hipped roof with cross gables and was constructed ca.1890. The house rests on a parged brick foundation and features a central brick chimney, standing-seam metal roofing, aluminum siding, vinyl 1/1-sash windows, a plain frieze, gable-end returns, a 2-story rear wing, and a rear 1-story gable-roofed wing with enclosed side porch. The 3-bay, hip-roofed front porch is supported by undersized turned spindles and has a balustrade of plain pickets.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, side-passage-plan, frame dwelling has a single window opening centered on the second floor, directly above the window on the first floor. The house has a shed roof clad in standing-seam metal with a Mansard roof on the front that gives the impression of a gable. The walls are clad in vinyl siding and the windows are 6/6-sash. The pedimented, 2-bay front porch has turned posts with turned balusters and gable-end returns. To the rear is a 1-story porch. The house is nearly identical to the one next door at 905 Grove Street (104-213-00390).



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1890** July 2006: This 2-story, 2-bay, side-passage-plan, vernacular frame dwelling has a single window opening centered on the second floor, directly above the window on the first floor. The house has a shed roof clad in standing-seam metal with a Mansard roof on the facade. The walls are clad in stucco and the windows are 6/6-sash. The shed-roofed, 2-bay front porch has square posts with lattice between the paired posts. To the rear is a shed-roofed porch. The house is nearly identical to the one next door at 903 Grove Street (104-0213-0040).

Individual Resource Status: Single Dwelling

Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This 2-story, 2-bay, cross-hip-roofed frame dwelling has a projecting front hipped roof and was constructed ca. 1895. The hip-roofed entrance bay is recessed. Clad in vinyl siding and roofed in asphalt shingles, the house features replacement vinyl 1/1sash windows and vinyl shutters, overhanging eaves, a boxed cornice, and a modern front door with 1-bay entrance porch supported by square posts. To the rear is a 1-story wing with central interior flue and side porch. *Individual Resource Status:* **Single Dwelling** Contributing *Total:* 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: Constructed ca. 1895, this 2-story, 2-bay, cross-hip-roofed frame dwelling has a projecting front hip roof. The hip-roofed entrance bay is recessed. Clad in stucco and roofed in asphalt shingles, the house features replacement vinyl 6/6-sash windows with vinyl shutters, overhanging eaves, a boxed cornice with plain friezeboard, and a 2-bay hip-roofed front porch with stuccoed square posts and a solid balustrade. To the rear is a 1-story wing with central interior flue.

TUPE 8



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This 2-story, 2-bay, hip-roofed, side-passage-plan, frame dwelling was constructed in the early 1890s and features bricktex siding, asphalt shingle roofing, and vinyl 1/1-sash windows, all replacement materials. The 3-light transom, 3-light sidelights, plain freizeboard, central parged chimney, and 3-bay front porch with square posts appear original. To the rear is an ell with a side wing.

Individual Resource Status:	Single Dwelling	Contributing	Total: 1	
Individual Resource Status:	Shed	Contributing		
Individual Resource Status:	Shed	Contributing	Total: 1	



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: Constructed in the early 1890s, this 2-story, 2-bay, cross-gable-roofed, sidepassage-plan, frame dwelling features a projecting front cross gable. The asphalt shingle roofing and aluminum siding are replacement materials. The wood 2/2-sash windows, 4light transom and 2-light sidelights, as well as the 3-bay front porch with square posts and plain pickets, appear original. To the rear is a 1-story gable-roofed wing that is attached to the shed by a breezeway.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Shed Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Queen Anne, ca 1895

July 2006: This large, 2-story, 4-bay, cross-gable-roofed, side-passage-plan, frame dwelling features a projecting, 2-story, front, cross-gabled, polygonal, Queen Anne-style, cutaway bay. The house, which has recently been rehabilitated is very well preserved and features a raised brick foundation, weatherboard siding, standing-seam metal roofing, a double-leaf front door with 3-light transom of frosted glass, a plain frieze, 2/2-sash wood

windows, and a 2-story, 2-level, 1-bay front porch with turned posts. The projecting, polygonal, cut-away front bay features a pedimented gable end with wooden shingles, a rectangular attic vent, and a decorative vergeboard.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: Constructed in the early 1890s, this 2-story, 2-bay, cross-gable-roofed, sidepassage-plan, frame dwelling features a projecting front cross gable. The standing-seam metal roof, weatherboard siding, central brick chimney, brick foundation, plain frieze, gable-end returns, and 2-light transom over the door are all original. The windows vary in size and configuration and include 8/8, 2/2 and 1/1-sash. The front door is modern and it appears that the square posts on piers that support the front 3-bay porch are replacements. To the rear is a 1-story gable-roofed wing with an end porch and a side lean-to. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: Constructed ca. 1895, this 2-story, 2-bay, cross-gable-roofed, side-passageplan, frame dwelling features an asphalt shingle roof, and asbestos shingle siding, both replacement materials. The vinyl 6/6-sash windows are replacements but the gable-end returns and the exterior brick chimney on the rear are original. The square posts on the 3bay front porch are replacements but the original turned pilasters are still evident along the wall of the house. It is similar in form to neighboring buildings, 1010 and 1012 Grove Street.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: Constructed ca. 1895, this 2-story, 2-bay, cross-gable-roofed, side-passageplan, frame dwelling features an asphalt shingle roof, and weatherboard siding. The vinyl 2/2-sash windows are replacements but the gable-end returns, exterior brick chimney on the rear, plain friezeboard, and wooden shingles in the gable ends are original. The 3-bay, hip-roofed, front porch with turned posts has been screened in. The house has a large 1story rear ell with a shed-roofed lean-to addition. It is similar in form to neighboring buildings, 1012 and 1008 Grove Street.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Shed Non-Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: Constructed ca. 1900, this 2-story, 2-bay, cross-gable-roofed, side-passage-plan, frame dwelling features an asphalt shingle roof, aluminum siding, both replacement materials. The 2/2-sash windows appear original as is does the exterior brick chimney located on the rear of the building. The front door is protected by a gable hood supported by brackets and the house has a 1-story rear wing, as do many of the other houses along this street. It is similar in form to neighboring buildings, 1010 and 1008 Grove Street.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Shed Non-Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.50, Style: Other, ca 1925 July 2006: This 2¹/₂-story, 2-bay, hip-roofed, brick American Foursquare dwelling was constructed ca. 1925. The walls are laid in 6-course American bond with Flemish bond and the house has a standing-seam metal roof with a front hip-roofed dormer that is clad in wood shingles. Architectural details include single and paired 6/1 windows, 3-light sidelights and a 5-light transom around the front door, segmental arches over the openings, overhanging eaves with exposed rafter ends, an interior brick chimney, and a rear 1-story wing. The 2-bay hip-roofed front porch has a wooden floor and Tuscan column supports.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 2-story, 2-bay, gable-end, side-passage-plan, frame dwelling clad in aluminum siding and with an asphalt shingle roof, was constructed in the early 1890s. The house rests on a parged brick foundation and has a central interior brick chimney. Other details include a plain friezeboard, a boxed cornice with gable-end returns, 2/2 windows, a 2-light transom over the door, and a rear 1-story wing. The 3-bay, hip-roofed front porch has a concrete floor and is supported by chamfered posts with sawn brackets.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Shed Non-Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, cross-gable-roofed, side-passage-plan, frame dwelling features an asphalt shingle roof and was constructed in the early 1890s. The house, which is clad in weatherboard siding, rests on a parged foundation and is missing its chimney. Other details include a plain friezeboard, gable-end returns, modern vinyl 1/1 windows, a single transom over the front doors, and a rear 1-story wing. The 3-bay hip-roofed front porch has the original standing-seam metal roofing and chamfered supports.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, cross-gable-roofed, side-passage-plan, frame dwelling features an asphalt shingle roof and was constructed in the early 1900s. The house, which is clad in weatherboard siding, rests on a parged foundation and has a central interior brick chimney. Other details include a plain friezeboard, gable-end returns, 2/6 windows, a polygonal bay window with 1/1 windows on the first floor, and a rear 2-story ell with side shed-roofed wing. The 2-bay, hip-roofed front porch has chamfered posts, and small brackets, and covers the front door that is surmounted by a 2-light transom. Individual Resource Status: Single Dwelling Contributing Total: 1




Primary Resource Information: Apartment Building, Stories 1.00, Style: Other, ca 1972

July 2006: This 1-story, gable-end, 8-unit brick apartment building was constructed ca. 1972 and features 4 bays on each side fronted by integral porches.

Individual Resource Status: Apartment Building Non-Contributing Total:1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 2003 July 2006: Constructed ca. 2003, this 2-story, 3-bay, gable-end, frame dwelling is clad in Hardi-plank and contains an integral 2-bay front porch with turned posts. The roofing is asphalt shingle and the windows are square 4-light sash and banked 4/1-sash. A rear 2-story gable-roofed wing is taller than the front section.

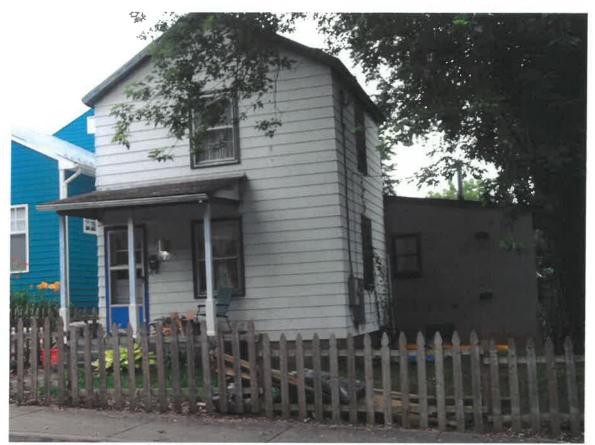

Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 2-story, 2-bay, side-passage-plan, gable-end, vernacular frame dwelling has a single window opening centered on the second floor, directly above the window on the first floor. Constructed ca. 1891, the house has a gable-end roof clad in standing-seam metal, and the walls are clad in aluminum siding. The exterior brick chimney located at the rear end of the gable is partially enclosed because of the rear 1-story wing that has been remodeled and enlarged with a side lean-to wing. This simply trimmed house has original 6/6-sash windows and a 2-bay, shed-roofed front porch with square posts. The brick pier foundation has concrete block infill.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: A 2-story, 2-bay, hip-roofed dwelling constructed ca. 1910, this vernacular hip-roofed house is clad in weatherboard siding with a roof covered in standing-seam metal. Almost identical to the house next door (1023 Grove), architectural details include a plain frieze, 3-light transom and 3-light sidelights, corner boards, interior brick chimney, a boxed cornice, 2/2-sash wood windows, brick foundation, 2-story rear ell, and modern vinyl shutters. The 2-bay, hip-roofed front porch has turned posts, exposed rafter ends, and turned balusters. A 1-story enclosed porch extends off the side of the ell. *Individual Resource Status:* Single Dwelling Contributing Total: 1

*1022 Grove Street 104-0245 Other DHR Id #: 104-0213-0232



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1891** July 2006: Listed on the National Register of Historic Places as part of the Charlottesville Multiple Resource Area District, this worker's cottage is also an Individually Protected historic property within the City of Charlottesville. The 2-story, 2-bay, side-passage-plan, gable-end, vernacular frame dwelling has a single window opening centered on the second floor, directly above the window on the first floor. Constructed in 1891 by James A. Gardner, the house has a gable-end roof clad in standing-seam metal, and the walls are clad in stucco. The exterior brick chimney located at the rear end of the gable is partially enclosed because of the rear 1-story wing. This simply trimmed house has original 6/6sash windows and a 2-bay, shed-roofed front porch with square posts and a 4-rail balustrade along the side.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: A 2-story, 2-bay, hip-roofed dwelling constructed ca. 1910, this vernacular hip-roofed house is clad in weatherboard siding with a roof covered in standing-seam metal. Almost identical to the house next door (1021 Grove), architectural details include a plain frieze, corner boards, interior brick chimney, a boxed cornice, 2/2-sash wood windows, brick foundation, 2-story rear ell, and modern vinyl shutters. The 2-bay, hip-roofed front porch has turned posts, exposed rafter ends, and turned balusters. A 1-story enclosed porch extends off the side of the ell.



July 2006: This 2-story, 2-bay, gable-roofed, vernacular, late-19th-century, frame dwelling rests on a parged foundation. The walls are clad in stucco and the house features an exterior brick chimney on the rear that is now partially enclosed because of a rear 1-story wing. Other details include asphalt shingle roofing, a single transom over the door, overhanging eaves, modern vinyl 1/1 windows, and a 3-bay, hip-roofed front porch with square posts.

Individual Resource Status: Single Dwelling Contributing Total: 1

1900



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1971 July 2006: This 1-story, 3-bay, vernacular dwelling was constructed ca. 1971 and features a raised concrete block foundation, 1/1 windows, aluminum siding, and an asphalt shingled gable roof.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890
 July 2006: This 2-story, 2-bay, side-passage-plan, frame dwelling has a single window opening centered on the second floor, directly above the window on the first floor. The house has a gable-end roof of standing-seam metal, with an exterior-end brick chimney, brick foundation, weatherboard siding with cornerboards, and 6/6-sash windows. The 3-bay front porch has turned posts and plain pickets. A 1-story, 1-bay, gable-roofed frame wing extends to the west and appears original. To the rear is a shed –roofed wing. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: A 2-story, 2-bay, hip-roofed dwelling constructed ca. 1900, this vernacular side-passage-plan house is clad in vinyl siding with a roof covered in asphalt shingles. Resting on a brick foundation, the house features a 3-bay, hip-roofed front porch with turned posts and balusters, modern vinyl 6/6-sash windows, a side 1-story wing, and a rear 1-story wing.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1940 July 2006: Constructed ca. 1940, this 1-story, 3-bay, vernacular frame dwelling is fairly well-preserved. The gable roof is clad in asphalt shingle and the frame walls in weatherboard siding. The 6/6-sash windows appear original as does the central brick flue, and the 1-bay shed-roofed front porch with turned posts.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Other, ca 1940 July 2006: Constructed ca. 1940, this 1-story, 3-bay, vernacular frame dwelling is clad in vinyl siding with an asphalt shingled gable roof. The house rests on a concrete block foundation and features 6/1 wood windows, a central brick chimney, and a 1-bay gabled front porch with paired square posts.



Primary Resource Information: **Single Dwelling**, **Stories 1.00**, **Style: Other**, **ca 1953** July 2006: Constructed ca. 1953, this 1-story, 3-bay, vernacular frame dwelling is clad in asbestos shingle siding with an asphalt shingled gable roof. The house rests on a concrete block foundation and features 1/1 wood windows, a 3-part bay window, a central concrete block flue, and a shed roof over the entrance.



Primary Resource Information: **Single Dwelling**, **Stories 1.00**, **Style: Other, ca 1953** July 2006: Constructed ca. 1953, this 1-story, 3-bay, gable-end, vernacular frame dwelling is clad in asbestos shingle siding with an asphalt shingled gable roof. The house rests on a concrete block foundation and features 1/1 wood windows, a 3-part bay window, a central concrete block flue, and a 2-bay gabled entry porch with modern square posts.



Primary Resource Information: **Single Dwelling**, **Stories 1.00**, **Style: Other**, **ca 1953** July 2006: Constructed ca. 1953, this 1-story, 3-bay, gable-roofed, vernacular frame dwelling is clad in asbestos shingle siding with an asphalt shingled gable roof. The house rests on a concrete block parged foundation and features 8/8 wood windows, a central concrete block flue, and cottage-style multi-light front door, and a 1-bay pedimented entry porch with square posts as supports.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This ca. 1900, 2-story, 2-bay, vernacular frame dwelling is currently abandoned with the window and door covered with plywood. The side-passage-plan dwelling features an asphalt shingle roof, asbestos shingle siding, a brick foundation, a plain friezeboard, gable-end returns, a central brick chimney, and a rectangular louvered front attic vent. The 3-bay, hip-roofed front porch has square posts and a solid balustrade covered in siding creating segmental-arched bays.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, gable-end, side-passage-plan, vernacular frame dwelling has a single window opening centered on the second floor, which lines up with the window on the first floor. The house has an asphalt shingled roof, the walls are clad in aluminum siding, and the vinyl 6/6-sash windows, and modern front door are replacements. A large exterior-end rear brick chimney is now enclosed because of a rear 2-story wing. An enclosed shed-roofed porch runs the length of the house along the west side. The split-level foundation is of brick with an entry along the east side. The front, 1bay, shed roofed porch has square posts and a modern balustrade.

Individual Resource Status:	Single	Dwelling Contributing	Total:	1
Individual Resource Status:	Shed	Non-Contributing	Total:	1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This unique, 2-story, 3-bay, cross-gable-roofed, vernacular frame dwelling has the unusual feature of a diagonal entrance bay at the junction of the two wings. The 2-story angled wall has a pedimented gable end and a 1-story, 3-bay polygonal entry porch with square posts and sawn brackets. The late-19th-century house rests on a split-level brick foundation, the walls are clad in asbestos shingle, and the roof is covered in standing-seam metal. Other details include a plain frieze, gable end returns, an interior-end brick chimney on the east wing, a central brick chimney on the west wing, 2/2-sash wood windows, and a rear 1-story wing.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:GarageContributingTotal:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This late-19th-century, 2-story, 2-bay, hip-roofed, vernacular frame dwelling has a projecting front hipped roof and a recessed gable-end entrance bay. Clad in aluminum siding and roofed in asphalt shingles, the house features 2/2-sash wood windows, some replacement vinyl 1/1-sash windows, a large central brick chimney, a parged foundation, a modern door with enclosed single-light transom, gable-end returns, overhanging eaves, and a rear 1-story wing. The front 2-bay front porch has square posts as supports although the original turned pilasters still survive.

915, 917 King Street 104-0213-0248



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Colonial Revival, ca 1946

July 2006: This ca. 1946, 1¹/₂-story, 3-bay, frame dwelling features a gable roof with two gabled front dormers and a large rear dormer. Of the Cape Cod- form, the house is clad in aluminum siding, and the roof is covered in asphalt shingles. It contains 6/6- and 8/8-sash wood windows, vinyl shutters, an exterior-end brick chimney (clad in aluminum siding), and fluted Colonial Revival-style trim around the front door. Concrete steps with metal railing lead up to a front stoop with an aluminum awning. To the side is a large deck with metal balustrade.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, side-passage-plan, gable-end, vernacular frame dwelling has a single window opening centered on the second floor, which lines up with the window on the first floor. Constructed ca. 1900, the house has a gable-end roof clad in asphalt shingles and walls clad in rectangular asphalt shingles. The exterior brick chimney located at the rear end of the gable is enclosed because of a rear 2-story wing. A 1-story rear shed-roofed wing extends off the end and side of the 2-story wing. The windows are 1/1-sash and the front, 2-bay hip-roofed porch has square posts. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This ca. 1900, 2-story, 2-bay, gable-end, side-passage-plan, frame dwelling is clad in aluminum siding and roofed in standing-seam metal. To the rear is an exterior brick chimney that is enclosed because of a rear 2-story wing. Off the rear of this wing is a modern 1-story addition that wraps around the side of the house. The 6/6-sash windows and overhanging eaves appear original as does the roof of the 2-bay front porch, which has modern metal supports.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Single Dwelling Non-Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This well-preserved, late-19th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, frame dwelling appears to be vacant. It features Bricktex siding, a standing-seam metal roof, original 2/2-sash wood windows, a brick pier foundation with concrete infill, and a plain frieze with brackets. An exterior brick chimney is located along the rear wall and other details include a transom over the 4-paneled door, overhanging eaves, a rear 1-story wing, and a 2-bay, hip-roofed front porch with chamfered posts on wood piers and a concrete floor.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This late-19th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, frame dwelling features stucco siding, asphalt shingle roofing, original 2/2-sash wood windows on the second floor and 1/1-sash vinyl windows on the first floor. Other details include a parged foundation, an exterior parged brick chimney along the rear wall, a transom over the door, a plain frieze, and a side and rear 1-story wing. The 2-bay, hip-roofed front porch has chamfered posts on wood piers, sawn brackets, plain pickets, a denticulated frieze, and a concrete floor.

Individual Resource Status: Single Dwelling Contributing *Total:* 1 *Individual Resource Status:* Shed Non-Contributing *Total:* 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This turn-of-the-century, 2-story, 3-bay, vernacular frame dwelling has receding bays from left to right. The narrowest of the three bays is the center entrance bay. The house is clad in vinyl siding with a tongue-and-groove wide wooden frieze with brackets. The 2/2-sash windows on the second floor are vinyl replacements, while the 1/1-sashes on the first floor are wooden. A transom is located over the front door. A 3bay, shed-roofed porch unites the central and right bays and has chamfered posts and sawn brackets. The house appears to have been remodeled and currently a large 2-story addition is being constructed to the rear.

Individual Resource Status:Single Dwelling ContributingTotal:1Individual Resource Status:ShedNon-ContributingTotal:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This ca. 1900, 2-story, 2-bay, gable-roofed, side-passage-plan, vernacular frame dwelling is clad in vinyl siding, with a standing-seam metal roof, double-hung 6/6-sash windows, and a brick foundation. The main chimney appears to be missing and the house has a large 1-story, hip-roofed rear wing with shed addition. Other details include overhanging eaves, a transom over the front door and a 3-bay hip-roofed front porch with turned posts and plain pickets.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This ca. 1900, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling is clad in vinyl siding, with an asphalt shingled roof, and vinyl 1/1-sash windows with vinyl shutters, all replacement materials. The main chimney appears to be missing and the house has a large rear1-story wing with interior flues. The house features overhanging eaves and a 3-bay, hip-roofed front porch with turned posts.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1900** July 2006: This 2-story, 2-bay, cross-gable-roofed, side-passage-plan, frame dwelling features an asphalt shingled roof and stucco siding. Constructed during the early 20th century, the entrance bay is recessed with a projecting front cross gable. The house rests on a parged foundation and is missing its chimney. Other details include a plain friezeboard, 2/2-sash wood windows, an enclosed transom and sidelights around the front door, and a rear 2-story ell with two 1-story wings off it. The 3-bay hip-roofed front porch has turned spindles and plain pickets.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1940** July 2006: This ca. 1940, 1-story, 3-bay, frame vernacular dwelling features a gable roof of standing-seam metal with a central brick flue. To the west is a 1-bay gable-roofed wing that is slightly set back from the main block. The stuccoed house contains 6/6-sash wood windows, exposed rafter ends, and a lean-to rear wing. The 1-bay, gabled front porch features square posts, exposed rafter ends and a concrete stoop.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This well-preserved, 2-story, 2-bay, cross-gable-roofed, side-passage-plan, frame dwelling features a standing-seam metal roof and vinyl siding. Constructed during the late 19th century, the house rests on a parged brick foundation and has an exterior brick chimney along the rear side gable, a plain friezeboard, gable-end returns, 2/2-sash wood windows with vinyl shutters, round wooden attic vents in the gable ends, and a transom and sidelights around the front door. To the rear is a 1-story wing and deck. The front 3-bay, hip-roofed porch has turned posts, a spindle frieze, and a balustrade of plain pickets.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1905** July 2006: This early-20th-century, 2-story, 2-bay, cross-gable-roofed, side-passage-plan, frame dwelling features an asphalt shingle roof and stucco siding. The house, which is clad in vinyl siding, rests on a brick foundation and has an interior brick chimney, a plain friezeboard, gable-end returns, modern vinyl 1/1 windows, round wooden attic vents in the gable ends, and a transom and sidelights around the front door. To the rear are a 2story ell and a 1-story wing. The front 3-bay, hip-roofed porch has square posts and a concrete pad.

Individual Resource Status: Single Dwelling Contributing *Total:* 1 *Individual Resource Status:* Shed Non-Contributing *Total:* 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 2-story, 2-bay, side-passage-plan, frame dwelling has a single window opening on the second floor, which lines up with the window on the first floor. Constructed ca. 1890, the gable-roofed frame house is clad in aluminum siding with a standing-seam metal roof. The 2/2-sash windows, exterior-end brick chimney, 2-light transom over the door and side 1-story wing are original. The 2-bay hip-roofed front porch has chamfered posts and modern metal railing. To the rear is a 1-story enclosed porch. The house is nearly identical to the one next door at 1017 King Street (104-0213-0251).

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Shed Non-Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 2-story, 2-bay, side-passage-plan, frame dwelling has a single window opening on the second floor, which lines up with the window on the first floor. Constructed ca. 1890, the gable-roofed frame house is clad in vinyl siding with an asphalt shingled roof, and modern 1/1-sash vinyl windows. Other details include an exterior-end brick chimney, a 2-light transom over the door, a rear shed-roofed 1-story wing, and a 2bay hip-roofed front porch with modern iron supports. One bay of the side 1-story wing appears original, with the second bay added at a later time. The house is nearly identical to the one next door at 1015 King Street (104-0213-0250).



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1905** July 2006: This 2-story, 2-bay, side-passage-plan, vernacular frame dwelling has a single window opening centered on the second floor, which lines up with the window on the first floor. Constructed ca. 1905, the house has a gable-end roof clad in asphalt shingles and walls clad in stucco. The exterior brick chimney located at the rear end of the gable is partially enclosed because of the rear 1-story wing that has been remodeled and enlarged with a side lean-to wing. This simply trimmed house has original 6/6-sash windows, a parged foundation, a side 1-story shed-roofed modern wing with entrance, and a shedroofed enclosed front porch.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1905 July 2006: This 2-story, 2-bay, cross-gable-roofed, side-passage-plan, frame dwelling features an asphalt shingle roof and was constructed around the turn-of-the-century. The house, which is clad in vinyl siding, rests on a parged foundation and has an interior brick chimney with a plain cap. Other details include a plain friezeboard, gable-end returns, modern single and paired vinyl 1/1 windows, a side 1-story modern wing, and several rear 1-story wings. The 3-bay hip-roofed front porch has square posts and plain pickets. *Individual Resource Status:* Single Dwelling Contributing *Total:* 1

*632 West Main Street 104-0376 Other DHR Id #: 104-0213-0085





Primary Resource Information: Church, Stories 1.00, Style: Late Victorian, ca 1877 July 2006: Listed on the Virginia Landmarks Register and the National Register of Historic Places, the corner stone for the First Baptist Church was laid in 1877 and completed in 1883. The rectangular 3-bay brick building is an excellent example of the Romanesque Revival style and features a projecting brick square entrance tower topped by an octagonal wooden lantern on a square base. The main entry is at the base of the tower through paneled double-leaf doors with a segmental-arched lintel. Matching projecting brick towers stand at the façade corners and rise slightly above the roof eaves. The gabled roof is clad in asphalt shingles. The 6-bay sides of the brick building are articulated into bays by projecting piers that also serve to buttress the high walls, and contain double-hung, round-arched stained-glass windows and a corbelled brick cornice. The rear of the building has a hip-roofed rectangular apse with a taller gable-roofed projecting. A corbelled brick water table separates the basement level from the main floor. The basement level windows contain square headed 6/9-sash windows.

Individual Resource Status: Church Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This ca. 1890, 2-story, 2-bay, frame dwelling has a cross-gabled roof with a projecting front gable. Clad in German-lap siding and covered in a roof of standing-seam metal, the house rests on a brick foundation and features a central brick chimney with corbelled cap, 2/2-sash windows, round wooden attic vents, a bracketed frieze; gable-end returns, and a double-leaf front door with 3-light transom and sidelights. The 3-bay front porch has a Mansard roof, chamfered posts, turned balusters, and a frieze with quatrefoil cutouts. To the rear is a 1-story wing with an enclosed integral side porch. The house is almost identical to its neighbor at 712 Nalle Street.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1993
 July 2006: The 2-story, 2-bay, gable-end frame vernacular dwelling was constructed ca.
 1993 and is clad in vinyl siding, with vinyl 6/6 windows and an asphalt shingle roof.
 Individual Resource Status: Single Dwelling Non-Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 3-bay, 2-story, hip-roofed, frame I-house features a central-front gable, brick foundation, asbestos siding and a standing-seam metal roof. The gable-end returns, 2-light transom over door, projecting 1-story polygonal bay on front, round attic vent, and 8-bay wraparound porch with turned spindles, balusters and brackets all seem to be original. The 1/1-sash windows may be a later replacement.

TYPE 4



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This ca. 1895, 2-story, 2-bay, frame dwelling has a cross-gabled roof with a projecting front gable. Clad in German-lap siding and covered in a roof of standing-seam metal, the house rests on a brick foundation and features a central brick chimney with corbelled cap, 1/1-sash windows, round wooden attic vents, a bracketed frieze, gable-end returns, and a double-leaf front door with 3-light transom and sidelights. The 5-bay wraparound front porch has a Mansard roof, Tuscan column posts and turned balusters. To the rear is a 1-story wing with an integral side porch. The house is almost identical to its neighbor at 708 Nalle Street.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This fairly large 2-story, 2-bay, frame dwelling has a cross-gabled roof with a projecting front gable. Clad in asbestos shingles and covered in a roof of standing-seam metal, the house rests on a brick foundation and features a central brick chimney, 2/2-sash windows, louvered wooden shutters, round wooden attic vents, plain friezeboard, gable-end returns, and a front door with transom and sidelights. The 3-bay front porch has a Mansard roof, chamfered posts, sawn balustrade and brackets. To the rear is a 2-bay one-story gable-roofed wing with central brick chimney and 2/2-sash windows.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:ShedContributingTotal:1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895
July 2006: This ca. 1890, 2-story, 2-bay, frame dwelling has a cross-gabled roof with a projecting front gable. Clad in weatherboard siding and covered in a roof of standing-seam metal, the house rests on a brick foundation and features a central brick chimney, 2/2-sash windows, round wooden attic vents, a bracketed frieze; gable-end returns, and a front door with 3-light transom and 2-light sidelights. The 3-bay front porch has a Mansard roof, chamfered posts, plain balusters, scroll brackets and a frieze with quatrefoil cutouts. To the rear is a 1-story wing with an enclosed integral side porch. *Individual Resource Status:* Single Dwelling Contributing *Total:* 1

TYPE Z

- 227 -



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890
 July 2006: A 2-story, 2-bay, hip-roofed frame dwelling constructed ca. 1890, this house is clad in weatherboard siding with a roof covered in asphalt shingle. One of the only forms like this in the neighborhood, architectural details include a plain frieze, corner boards, a single transom over the door, modern 2/2-sash vinyl windows, a rear 1-story wing, a central brick chimney, and a 2-bay, hip-roofed front porch with chamfered posts and sawn brackets and balustrade. It appears that the house has recently been renovated. *Individual Resource Status:* Single Dwelling Contributing Total: 1

natviauat Resource Status. Single Dwennig Controuting Total.

- 228 -

YPE



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style**: **Other**, **ca 1890** July 2006: Constructed ca. 1890, this 2-story, 3-bay cross-gable-roofed dwelling has two front cross gables, one of which projects forward. Clad in weatherboard siding and covered in a roof of standing-seam metal, the house rests on a brick foundation and features two central brick chimneys, 2/2-sash windows, round wooden attic vents, a plain frieze, a front door with 3-light transom and 3-light sidelights. The 5-bay front porch has a Mansard roof, chamfered posts, scroll brackets, and a sawn balustrade. To the rear is a 1-story gable-roofed wing.

Individual Resource Status: **Single Dwelling** Contributing *Total:* 1 *Individual Resource Status:* **Shed** Contributing *Total:* 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This fairly large 2-story, 2-bay, frame dwelling has a cross-gabled roof with a projecting 2-level, pedimented porch with Victorian detailing as well as a projecting front gable. Clad in asbestos shingle and covered in a roof of standing-seam metal, the house rests on a brick foundation and features a central brick chimney, 2/2-sash windows, gable-end returns, and rectangular attic vents. The first-floor, 3-bay porch, which has two doors opening out to it, has a Mansard roof, turned posts, plain pickets, and sawn brackets, while the second-story pedimented gable-end porch is 1-bay wide. Other details include an enclosed 1-story rear porch, a projecting rectangular 1-story bay on the east side, plain frieze and overhang eaves.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1900** July 2006: Currently vacant, this late-19th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, frame dwelling features a cross gabled roof clad in asphalt shingle. The central brick chimney is parged as is the foundation, which is also of brick. The frame walls are covered in aluminum siding and the house has 2/2-sash and 1/1-sash windows, a transom over the door, a plain frieze, a rear 2-story ell, and a 1-story rear wing. The 3-bay hip-roofed front porch has chamfered posts, turned spindles and a denticulated cornice.



Primary Resource Information: Single Dwelling, Stories 1.00, Style: Bungalow/Craftsman, ca 1915

July 2006: This 1-story, 3-bay, vernacular frame bungalow was constructed ca. 1915. The low-pitched gable-end roof is clad in asphalt shingle and the front, 1-bay porch, with paired square posts on brick piers; has a lower cross gable-end with wood shingles and a rectangular attic vent. The house is clad in weatherboard and wood shingle siding and features and exterior-end brick chimney, overhanging eaves, exposed purlin ends, a transom over a modern front door, and a modern shed-roofed front wing.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1910** July 2006: This 2-story, 2-bay, frame vernacular dwelling has a hipped roof with a central front pedimented gable containing louvered attic vents. Constructed ca. 1910, the house rests on a brick foundation, is clad in vinyl siding, and has a roof covered in asphalt shingles. The wood windows are 1/1-sash and the house has overhanging eaves, two brick chimneys with corbelled caps, a transom over the door and a 3-bayhip-roofed front porch with Tuscan columns.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:GarageContributingTotal:1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, frame vernacular dwelling has a hipped roof with a central front gable with gable-end returns and a round attic vent. Constructed ca. 1910, the house rests on a parged foundation, is clad in vinyl siding, and has a standing-seam metal roof. The wood windows are 2/2-sash and the house has overhang eaves, two brick chimneys, a plain frieze, gable-end returns, and a 3-bay hip-roofed front porch with Tuscan columns on concrete piers.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1900** July 2006: This 1890s, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features a hipped roof with a projecting front cross gable. The roof is clad in standing-seam metal with a corbelled brick chimney. The walls have been covered in asbestos shingle and the windows replaced with 1/1 wood sash, but the plain friezeboard, gable-end returns, transom over the door, and 3-bay front porch with turned posts on wood piers, triangular brackets, and turned balusters appear original. A 1-story hip-roofed wing extends to the rear.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This ca. 1890, fairly large, 2-story, 3-bay, L-shaped vernacular dwelling has a gabled roof with a front projecting cross gable. Currently clad in bricktex siding, the roof of the house is covered in asphalt shingle. The 2/2 windows, plain frieze, brick foundation, gable-end returns, brick chimney, and 3-bay front porch with turned spindles, brackets, and spindle frieze, all appear original. To the side is a projecting 2-story wing and a shed-roofed wing extends to the rear.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 1890s, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features a hipped roof with a projecting front cross gable. The roof is clad in standing-seam metal with a brick chimney. The walls have been covered in vinyl siding, but the 2/2-sash windows, plain friezeboard, gable-end returns, transom over the door, and 3-bay front porch with turned posts and sawn brackets appear original. To the rear is a 1-story wing.

742, 744 Nalle Street 104-0226 Other DHR Id #: 104-0213-0027



Primary Resource Information: Multiple dwelling, Stories 1.00, Style: Other, ca 1979

July 2006: Constructed in 1979, this 1-story, 2-bay, gable-end vernacular frame duplex is clad in board and batten siding, and has an asphalt shingle roof and a side deck. One door is on the gable end, while the other is on the side gable.

Individual Resource Status: Multiple dwelling Non-Contributing Total:1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, frame dwelling features a cross-gabled roof clad in asphalt shingle. The central brick chimney has a corbelled cap and the house rests on a brick foundation. The frame walls are covered in vinyl siding and the house has modern paired and single 1/1-sash windows as well as a modern front door with 1-bay pedimented portico with square posts. Original features appear to be the gable-end returns, plain frieze, and rear ell. Two 1-story wings extend off the back and the house, which has now been converted into a duplex, features an exterior staircase along the west side.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This ca. 1900, 2-story, 2-bay, side-passage-plan, frame dwelling features a cross gabled roof clad in asphalt shingle. The central brick chimney is parged as is the brick foundation. The frame walls are covered in vinyl siding and the house has modern paired and single 1/1-sash windows as well as a modern front door with round-arched transom. Original features appear to be the gable-end returns, plain frieze and 3-bay front porch with turned posts, sawn brackets, and plain pickets. To the side is a 1-story gabled wing.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This 3-bay, 2-story frame I-house features a central front gable, parged foundation, aluminum siding and an asphalt shingled roof. The 2/2-sash windows, gableend returns, 2-light basement windows, and 3-bay front porch with turned posts and triangular brackets, appear to be original. To the rear is a 1-story wing.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Garage Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 3-bay, gable-end, abandoned vernacular frame dwelling has several rear and side additions. Constructed ca. 1900, the house, which rests on a brick foundation, has stucco-clad walls, a roof covered in asphalt shingle, 2/2-sash windows, and several interior brick parged chimney. The house, which appears to have been vacant for several years, has boarded-up front windows and a 1-bay front porch with modern aluminum supports.

Individual Resource Status:	Single Dwelling	Contributing	Total:	1
Individual Resource Status:	Shed No.	n-Contributing	Total:	1

803 Nalle Street 104-0225 *Other DHR Id #:* **104-0213-0095**



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This 2-story, 2-bay, hip-roofed, side-passage-plan, stuccoed frame dwelling features a hipped roof with cross gables and was constructed ca. 1890. The house features a central parged chimney, asphalt shingle roofing, stuccoed siding, 2/2-sash windows, a plain frieze, gable-end returns, round wooden attic vent in the gable ends, and a transom and sidelight around the front door. The 3-bay, hip-roofed front porch is supported by stuccoed posts that form round-arched bays. The solid balustrade has also been stuccoed. To the rear is a one-story gable-roofed wing.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This 2-story, 2-bay, hip-roofed, side-passage-plan, frame dwelling features a hipped roof with cross gables and was constructed ca. 1890. The house features a central parged chimney, asphalt shingle roofing, weatherboard siding, 2/2-sash windows, a plain frieze, gable-end returns, square wooden shingles and a round wooden attic vent in the gable ends, and a transom and sidelight around the front door. The 3-bay, hip-roofed front porch is supported by turned posts with sawn brackets, and a modern railing.

Individual Resource Status: Single Dwelling Contributing Total: 1 Individual Resource Status: Garage Non-Contributing Total: 1

- 244 -

TYPE 1

Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This 3-bay, 2-story frame I-house features a central-front gable, parged foundation, weatherboard siding and a standing-seam metal roof. The 2/2-sash windows, central brick chimney, plain frieze, round attic vent, basement windows, 4-light transom and sidelights around the front door appear original. The 3-bay front porch features turned spindles, balusters, and brackets. To the rear is a 1-story shed-roofed wing. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This fairly large 2-story, 2-bay, frame dwelling has a cross-gabled roof with a projecting front gable. Constructed around the turn-of-the-twentieth-century, the house, clad in weatherboard siding, rests on a brick foundation, and features a standing-seam metal roof, a central brick chimney, 2/2-sash windows, round wooden attic vents, plain friezeboard, gable-end returns, and a front door with transom. The 3-bay front porch has turned spindles, balusters and a sawtooth wood frieze with pendants. To the rear is a large 2-story wing with a 1-story partially enclosed porch.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, vernacular frame dwelling has a cross-gabled roof with a projecting front gable. Constructed around 1890 the house, originally clad in weatherboard siding and now covered in stucco, has a slate shingle roof, and rests on a solid foundation. It features a central brick chimney, 2/2-sash windows, round wooden attic vents, gable-end returns, a double-leaf front door with transom, and a 3-bay front porch with stuccoed square supports, stuccoed sold balustrade, and stuccoed segmental bays.



Primary Resource Information: Single Dwelling, Stories 2.50, Style: Other, ca 2003 July 2006: This 2-story, cross-gabled vernacular dwelling was constructed in 2003, on the site of an earlier building. The building rests on a raised basement and the walls are clad in cementious weatherboard siding.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This early-1890s, 2-story, 2-bay, hip-roofed, side-passage-plan, stuccoed, vernacular frame dwelling features a hipped roof with a projecting front cross gable. The roof is clad in asphalt shingle and no chimney was visible. Although the walls have been stuccoed, the plain friezeboard, gable-end returns, 2/2-sash windows, transom over door, and round wooden attic vent in the gable ends are still present. The round-arched, 3-bay front porch has stuccoed square supports and a solid stuccoed balustrade. To the rear is a long 1-story gable-roofed wing with a side porch with similar detailing as the front porch. Individual Resource Status: Single Dwelling Contributing Total: 1



829 Nalle Street 104-0224 Other DHR Id #: 104-0213-0025

Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, hip-roofed, side-passage-plan, frame dwelling features a hipped roof with cross gables and was constructed ca. 1890. The house rests on a brick foundation and features a central parged chimney, v-crimp metal roofing, weatherboard siding, 2/2-sash windows, a plain frieze, gable-end returns, wood shingles and a round wooden attic vent in the gable ends, and a transom over the modern front door. The 7-bay, wraparound, hip-roofed front porch is supported by turned posts and contains sawn brackets, and plain pickets. The house extends to the rear with a gabled ell that has an enclosed side 1-story porch.

854 Nalle Street 104-0213-0032



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1925** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling appears to have been constructed ca. 1925. It is clad in weatherboard siding, rests on a brick foundation, and has a standing-seam metal roof. Architectural details include a central brick chimney, overhanging eaves, exposed rafter ends, 1/1- and 3/1-sash windows, a single transom over the door, and a 2-bay hip-roofed front porch with battered square posts and exposed rafter ends. To the rear is a one-story wing.

856 Nalle Street 104-0213-0033



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Other, ca 1930 July 2006: This 1½-story, 3-bay, frame vernacular dwelling features a jerkinhead roof and side and front jerkinhead dormers. Constructed ca. 1930, the house, now clad in aluminum siding and with a roof clad in asphalt shingle, features, 4/1-sash windows, a split-level foundation, a central front door, parged foundation, and 3-bay front porch with square posts, piers, and plain pickets.

858 Nalle Street 104-0213-0034



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Other, ca 1930 July 2006: This 1 ¹/₂-story, 3-bay, frame vernacular dwelling features a gable-end roof with an integral, 1-bay, front corner porch. Constructed ca. 1930, the house, clad in stucco and with a roof clad in asphalt shingle, features single and paired 3/1-sash windows, a split-level foundation, gable-end returns, a central brick chimney, and square porch posts.

901, 903 Nalle Street 104-0213-0021



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1890

July 2006: This 2-story, 4-bay, frame duplex features a hipped roof clad in standing-seam metal, asbestos shingle siding, 2/2-sash windows, a bracketed frieze with overhang. Constructed ca. 1890 the building features two doors on the front, in each of the end bays, a 4-bay hip-roofed front porch with square posts, 2 interior brick chimneys, and a rear 1-story hip-roofed wing with lean-to additions.


Individual Resource Status: Multiple dwelling

Contributing Total: 1

907, 909 Nalle Street 104-0213-0011



Primary Resource Information: **Dwelling/Store**, **Stories 2.00**, **Style: Other, ca 1915** July 2006: This 2-story, 4-bay, shed-roofed, vernacular frame building was constructed ca. 1915 as a grocery store and later converted into a duplex. The building has weatherboard siding, asphalt shingle roofing, a poured concrete foundation, and 2/2-, 1/1and 6/6-sash windows. A small 3-bay porch with chamfered posts is located on the second floor while the first-floor porch has been enclosed with two entrance doors and modern 1/1-sash windows. To the rear is a shed-roofed wing.

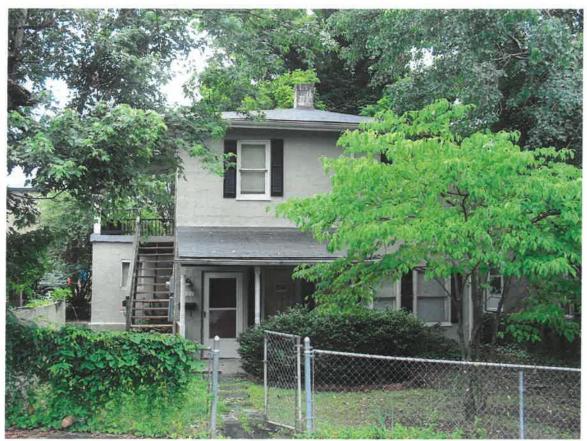

Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1940** July 2006: This ca. 1940, 2-story, 2-bay, pyramidal-roofed vernacular dwelling is of concrete block construction with overhanging eaves, exposed rafterends, a central concrete block flue, and 6/6- and single and paired 1/1-sash wood windows. The house, now used as a duplex has a 1-story flat-roofed wing and exterior wooden stair along the east side that lead up to the second-story apartment. The 2-bay, shed-roofed front porch has turned supports.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1910** July 2006: This early-20th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features a central-front gable. The house, clad in stucco siding, and roofed in asphalt shingles, features overhanging eaves, a central brick flue, a plain frieze, a 3-light transom and sidelights around the front door, 2/2-sash wood windows, a rear 2-story hip-roofed wing, and a 3-bay hip-roofed front porch with square posts and a modern balustrade.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: This early-20th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features a central-front gable. Clad in weatherboard siding and roofed in asphalt shingles, the house features overhanging eaves, a central metal flue, a plain frieze, cornerboards, 2/2-sash wood windows, a 3-light transom and sidelights around the front door, a rear 2-story hip-roofed wing, and a 3-bay hip-roofed front porch with square posts and plain pickets.



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other**, **ca 1910** July 2006: This early-20th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling is clad in vinyl siding, with an asphalt shingled roof, both replacement materials. The house features overhanging eaves, a plain frieze, 1/1-sash vinyl-clad windows and vinyl shutters, a transom over the door, a new front door, a rear 2-story hip-roofed wing, and a 2-bay hip-roofed front porch with turned posts and spindle brackets. One of the two interior flues is of concrete block, while the other is of brick. A 2-story wing extends to the rear.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1910 July 2006: This early-20th-century, 3-bay, 2-story frame I-house features a central-front gable, brick foundation, weatherboard siding, and an asphalt shingled roof. The 2/2-sash windows, interior-end brick chimney, overhanging eaves, exposed rafter ends, and rear ell are original. The 3-bay front porch features turned posts.

Individual Resource Status:	Single Dwelling	Contributing	Total:	1	
Individual Resource Status:	Garage	Contributing	Total:	1	



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, pre 1853

July 2006: The center core of this 2-story, 3-bay, frame I-house was constructed pre-1853 by local master builder Allen Hawkins. Originally a 1 ½-story building with brick end chimneys, the house evolved into its current configuration around 1880 by William Dyer Wheeler. This expansion included the demolition of the original chimneys, the extension of the building seven feet to the east, an increase in the height of the house to a full two stories, construction of a gabled roof with central-front gable, and the addition of two exterior-end brick chimneys. The frame house is clad in weatherboard siding and features a standing-seam metal roof. Other details include a brick foundation, two exterior-end brick chimneys that pierce through the overhanging eaves, plain corner boards, a 4-light transom and single-light sidelights, and 2/2-sash wood windows with louvered wooden shutters (some of which are closed). The front 3-bay hip-roofed porch has chamfered-post supports on brick piers and sawn brackets. A 1-story frame wing extends to the rear and appears to have been constructed around the same time that the front portion was expanded ca. 1880. It features a gabled roof, interior brick chimney, and side lean to. It was enlarged around 1912 to its current configuration.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This late-19th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features a hipped roof with a projecting front cross gable. The roof is clad in standing-seam metal and contains a central brick chimney. The frame walls are covered in stucco, the windows are 2/2-wood sash, and the house has a plain friezeboard, gable-end returns, a transom over the front door, and a 3-bay hip-roofed front porch with turned spindles and plain pickets. A 2-story wing extends to the rear. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1895 July 2006: This ca. 1895, 2-story, 2-bay, hip-roofed, side-passage, vernacular frame dwelling features a hipped roof with a projecting front cross gable. The roof is clad in asphalt shingles and is pierced by a central brick chimney. The frame walls have been covered in stucco, the windows replaced with 1/1 vinyl sash, and the first-floor window in the projecting cross gable converted into a doorway making the building a duplex. The plain friezeboard, gable-end returns, and 3-bay hip-roofed front porch with turned spindles and plain pickets appear original. A 1-story hip-roofed wing extends to the rear. Individual Resource Status: Single Dwelling Contributing Total: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 2-bay, gable-roofed, vernacular frame dwelling has a central front gable and appears to have been constructed during the late 19th century. The two bays are not centered within the façade, while the prominent central front gable is, giving the building an interesting appearance. The well preserved house has stucco cladding, a parged foundation, 2/2-sash wood windows, a central brick flue, a plain friezeboard, overhanging eaves, gable-end returns, and a front door with 3-light transom and 3-light sidelights. A 1-story wing extends to the south side, and a 2-story wing on a split-level, walk-out stone foundation extends to the rear. A 2nd-story wing on piers extends off the rear wing. The front 3-bay hip-roofed porch has turned spindles and segmental bays. *Individual Resource Status:* Single Dwelling Contributing *Total:* 1



Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 2-story, 2-bay, hip-roofed, side-passage-plan, vernacular frame dwelling features a cross-gabled roof clad in standing-seam metal. The central interior chimney is constructed of brick. The brick pier foundation has been filled in with concrete block. The frame walls are covered in aluminum siding and the house has 2/2-sash wood windows, a 3-light transom and sidelights around the front door, gable-end returns, a plain frieze, a rear 2-story ell with a 2-story shed-roofed side wing, and a rear 1-story wing with screened-in rear porch. The 3-bay, hip-roofed front porch has battered posts on brick piers and plain wooden balusters.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This late-19th-century, 2-story, 3-bay, hip-roofed vernacular dwelling features a 2-story 2-level, 3-bay, shed-roofed front porch. The first floor has turned posts and plain pickets while the second floor has square posts and a solid balustrade. The house follows a side-passage-plan and the front door has 3-light sidelights. The house features weatherboard siding, a standing-seam-metal roof, overhanging eaves, a plain frieze, cornerboards, and a parged foundation. The windows are all modern vinyl 2/2sash with the exception of the second-story front windows that are full-height vinyl sash and the modern full-light door leading out to the second-story porch.



Primary Resource Information: **Single Dwelling, Stories 2.00, Style: Other, ca 1925** July 2006: This ca. 1925, 2-story, 3-bay, hip-roofed frame dwelling is asymmetrical. The vernacular building rests on a split-level brick foundation and has a central brick flue, 2/2-sash wood windows, aluminum siding, and a standing-seam metal roof. The 3-bay, hip-roofed front porch has turned posts and plain pickets and wooden handrail at the front steps.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:GarageContributingTotal:1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1940
July 2006: Currently vacant, this mid-20th-century, 2-story, 2-bay, vernacular gable-end
dwelling follows a side-passage plan. Clad in stucco with a parged foundation, the
dwelling's roof is of standing-seam metal. The single and paired wood windows contain
4/1 wood sashes, and a diamond-shaped attic window is found in the front gable end.
Other details include overhanging eaves, gable-end returns, a plain frieze, a side 1-bay
entrance porch, and a 3-bay hip-roofed front porch with turned posts and plain balusters.
Individual Resource Status: Single Dwelling Contributing Total: 1




Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1915** July 2006: Currently vacant, this early-20th-century, 2-story, 3-bay (originally 2-bay), cross-gable-roofed, side-passage-plan, vernacular frame dwelling features a large central-front gable, stucco siding, and an asphalt shingled roof. The window openings on the first floor have been plyboarded and the other windows contain modern 1/1-sash vinyl windows. The house was originally two bays wide but a second door was added, converting the single-family dwelling into a duplex. The house features overhanging eaves, a plain frieze, gable-end returns, a 6-light attic window in each of the cross gables, small basement windows, and a 3-bay front porch with battered square posts and plain wooden pickets and railing.



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1870

July 2006: This 2-story, 4-bay, symmetrical, hip-roofed frame duplex contains two front doors that are centered along the front façade; a window is located on the end bays. The frame walls are clad in stucco and the hipped roof in asphalt shingles. The building features a central brick flue. The foundation is parged and the wood windows are 6/6 sash. The double-pile building contains a 4-bay, hip-roofed front porch with square posts, and a modern rear deck. Although the duplex is relatively plain and reflects an early- to mid-20th-century vernacular form, Fall/Winter 2006 renovations have exposed that the core of the building appears to date to the mid-19th century.

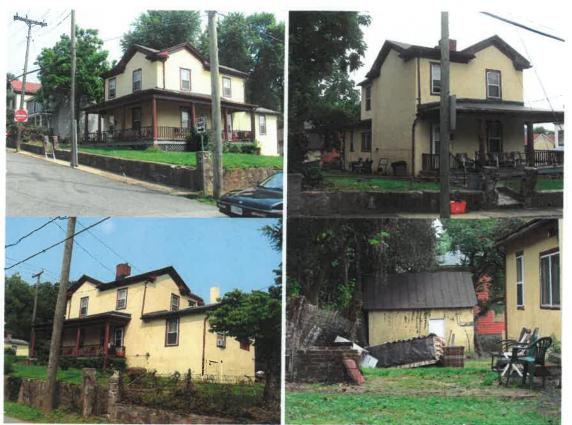

Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 2-story, 2-bay, side-passage-plan, vernacular frame dwelling features a cross-gabled roof clad in asphalt shingle. The central interior chimney is constructed of brick as is the partially parged split-level foundation. The frame walls are clad in stucco and the house has 2/2-sash wood windows, an enclosed transom over the door, gable-end returns, a plain frieze, a rear 2-story ell with a 2-story shed-roofed side wing, and a rear 1-story wing with a basement entry. The 6-bay, hip-roofed, wraparound front porch has Tuscan columns supports and a plain balustrade.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:GarageContributingTotal:1

202 Spring Street 104-0213-0223



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: The late-19th-century, 2-story, 2-bay, side-passage-plan, gable-end, vernacular frame dwelling has a single window opening centered on the second story, which lines up with the window on the first story. The house has a gable-end roof clad in standing-seam metal, and the walls are clad in asbestos shingle. The exterior brick chimney located at the rear end of the gable is partially enclosed because of the rear 1story wing. This simply trimmed house has modern vinyl 2/2-sash windows, a parged foundation, and a 3-bay, shed-roofed front porch with square posts.

Primary Resource Information: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, side-passage-plan, gable-roofed, late-19th-century frame dwelling has a single window opening centered on the second story, which lines up with the window on the first story. The house has a roof clad in asphalt shingles with an exterior-end brick chimney, a parged brick foundation, board-and-batten siding, 6/6-sash windows, and a side 1-story gable-roofed wing with a basement entry. The 3-bay front porch has square posts and a 3-rail balustrade.

Individual Resource Status: Single Dwelling Contributing Total: 1

204 Spring Street 104-0213-0222